

Technical Service Bulletin Number
--

TSB150156



Technical Service Bulletin

Subject

Turbocharger Coolant Hose Malfunction Caused by Hose Clamp

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Issue

The turbocharger coolant hose can leak as the result of damage caused by a hose clamp.


Product Affected

- B Gas International CM556
- B5.9 G
- B5.9 Gas Plus CM556
- B5.9 LPG
- B5.9 LPG Plus CM556
- ISB5.9 G CM2180

Verification

If the turbocharger coolant hose is leaking coolant, inspect the hose clamp installation area of the turbocharger coolant hose for damage. See Figure 1 below for an example of damage.

©Cummins Inc

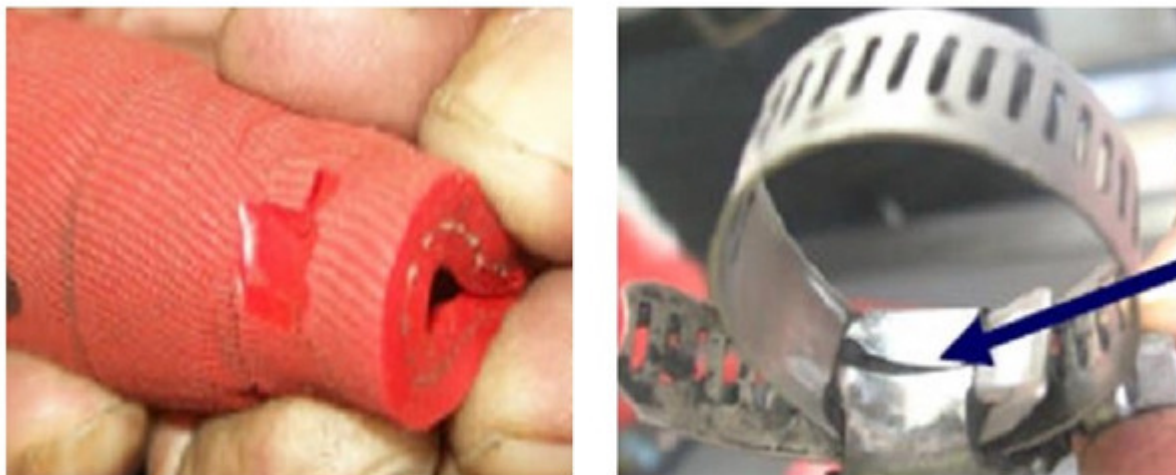

10r00149

Figure 1, Damage to Turbocharger Coolant Hose and Suspect Hose Clamp

Resolution

Replace the damaged turbocharger coolant hose. When installing the new turbocharger coolant hose use spring hose clamp, Part Number 5267079, instead of hose clamp, Part Number 3820672 or Part Number 5316194.

Service Parts

Table 1, Service Parts	
Part Description	Part Number
Spring Hose Clamp	5267079

Document History

Date	Details
2015-9-25	Module Created

Last Modified: 09-Oct-2015

Copyright © 2000-2010 Cummins Inc. All rights reserved.