

Service Bulletin

Service Bulletin - Technisches Rundschreiben - Circulaire Technique - Circular Tecnica

Date: 10th August 2015

Object: **Clutch Update**

Product: **F4 RC 2015**

Further to a continuous quality monitoring of our product, we introduced a clutch update.

It is therefore necessary to perform the update with new clutch kit on the following frame numbers:

ZCGMCFTW0FV005906	ZCGF620BCFV006131	ZCGF620BCFV006138	ZCGF620BCFV006145
ZCGF620BCFV006125	ZCGF620BCFV006132	ZCGF620BCFV006139	ZCGF620BCFV006146
ZCGF620BCFV006126	ZCGF620BCFV006133	ZCGF620BCFV006140	ZCGF620BCFV006147
ZCGF620BCFV006127	ZCGF620BCFV006134	ZCGF620BCFV006141	ZCGF620BCFV006148
ZCGF620BCFV006128	ZCGF620BCFV006135	ZCGMCFTWXFV006142	ZCGF620BCFV006247
ZCGF620BCFV006129	ZCGF620BCFV006136	ZCGMCFTW1FV006143	ZCGF620BCFV006260
ZCGF620BCFV006130	ZCGF620BCFV006137	ZCGMCFTW3FV006144	ZCGF620BCFV006261

Material needed to be ordered to perform the intervention:

- N°1 piece cod. W000W1286 KIT FLANGE + PINS
- N°1 piece cod. W000W1287 CLUTCH KIT F4 RC

Installation procedure:

- Remove the clutch cover;
- Remove the clutch discs;
- Remove il clutch hub;
- Remove the clutch flange and install the new part, code W000W1286.



- Reassemble the clutch hub;
- Reassemble the clutch with the new springs and screws included in the kit code W000W1287;
- Reassemble the new pushrod with its pawl included in the kit code W000W1287;
- Reassemble the clutch cover using the gasket included in the kit W000W1287.



- Complete the motorcycle in all its parts.
- For anything not mentioned refer to the workshop manual.
- Test the bike before delivery to the customer.

In our and our customers interest, we ask you to perform, as soon as possible, the modification described in the previous instructions.

Warranty refund procedure:

Send Warranty Claim for reimbursement, in addition to the full details of the motorcycle and parts codes/quantity, indicating the following details:

- Warranty type = GS
- Special warranty number = 2804
- Spare Parts = W000W1286 - W000W1287
- Operation code = E 999
- Labor Time = 1,3 hours
- Problem code = 099

In the note of the warranty claim, please refer to the service bulletin N°159

The reimbursement of the warranty claim will be processed through Invoice, as usually. Thanking you in advance for your cooperation, we remain at your disposal for any technical / commercial support.

Best Regards
 MV AGUSTA MOTOR S.p.A.
 Technical Service Support