

Service Bulletin

Service Bulletin - Technisches Rundschreiben - Circulaire Technique - Circular Tecnica

Date: 10th August 2015

Object: **Cable relocation key switch ZADI**

Product: **F4 RC 2015**
ZCGMCFTW0FV005906
ZCGMCFTW1FV006272

With this service bulletin we inform you that is necessary to modify the key switch ZADI on model F4 RC 2015. These changes are the result of the constant surveillance of the quality of our product.


We ask you to perform the action described below before delivery to the final customers users.

It is therefore necessary the intervention on the following frame numbers:

ZCGF620BCFV005903	ZCGF620BCFV006129	ZCGF620BCFV006137	ZCGF620BCFV006145
ZCGF620BCFV005904	ZCGF620BCFV006130	ZCGF620BCFV006138	ZCGF620BCFV006146
ZCGF620BCFV005905	ZCGF620BCFV006131	ZCGF620BCFV006139	ZCGF620BCFV006147
ZCGMCFTW0FV005906	ZCGF620BCFV006132	ZCGF620BCFV006140	ZCGF620BCFV006148
ZCGF620BCFV006125	ZCGF620BCFV006133	ZCGF620BCFV006141	ZCGF620BCFV006247
ZCGF620BCFV006126	ZCGF620BCFV006134	ZCGMCFTWXFV006142	ZCGF620BCFV006261
ZCGF620BCFV006127	ZCGF620BCFV006135	ZCGMCFTW1FV006143	ZCGMCFTW1FV006272
ZCGF620BCFV006128	ZCGF620BCFV006136	ZCGMCFTW3FV006144	

DESCRIPTION OF THE DEFECT:

As the picture in attached.

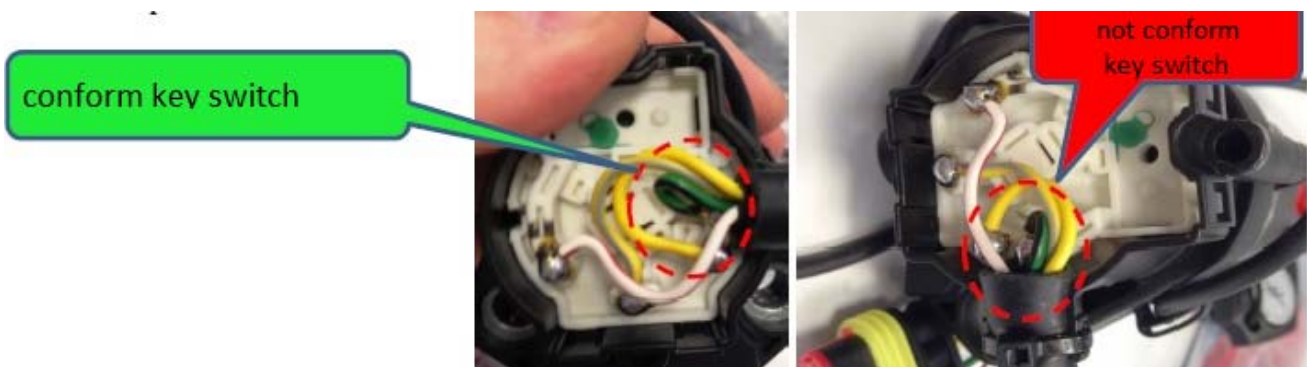


On motorcycles involved in this service bulletin, the green/black wire in some cases is too stretched. This problem in addition to the vibrations and twists due to movement of the steering, may result in loosening or detachment of the contact in the ignition switch.


MODIFICATION PROCEDURE – Key switch ZADI

Is NOT necessary order any spare parts

- Remove the key switch from the bike, respecting the removal instructions given in the workshop manual.
- In the fixing area of the wires to the main switch, free the black sheath that covers the wires by any obstacles and closure, in order to leave the cables free to slide.
- Pull gently a bit out the wire green/black from the sheath, in order to leave some free play, as illustrated in the image below.

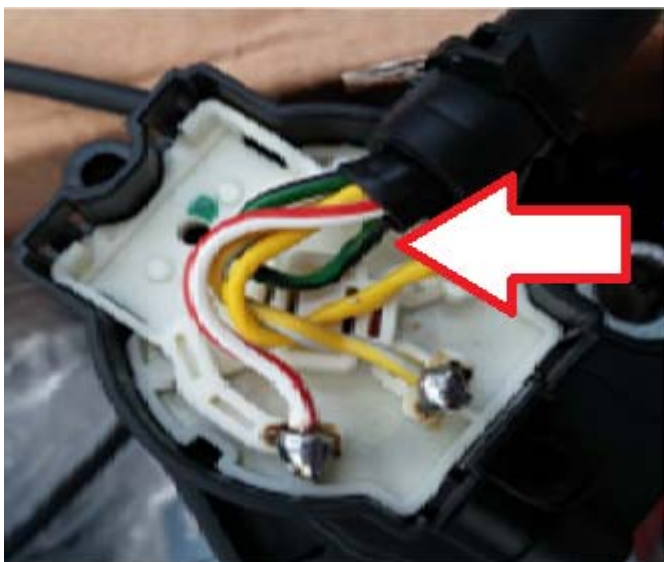

- Once relocated the green/black, prevent it from sliding, securing it with a plastic locking tie to other wires as shown in the image below.

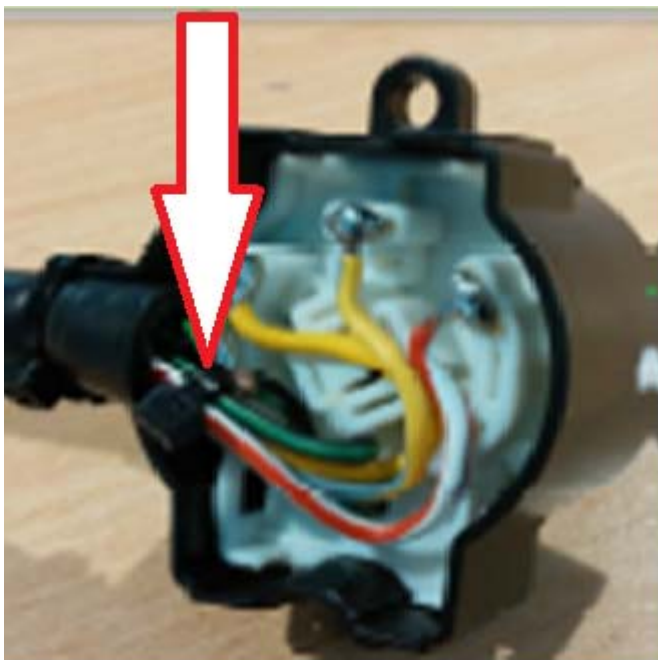

- At last reassemble the key switch following the installation instructions reported in the workshop manual, and test the motorcycle before delivery to the customer.

PROCEDURE FOR WARRANTY REIMBURSEMENT

Please follow the usual procedure to request the warranty reimbursement:

- Send the request for warranty reimbursement.
- In addition to the full details of the motorcycle, please indicate:

- Warranty type = GS
- Special warranty number = 2804
- N° 1 piece code 8000B4373 plastic tie
- Operation code = T 999
- Labor time = 0,7 hours
- Problem code = 099

- In the note of the warranty, please refer to the service bulletin n° 158

Thanking you in advance for your cooperation, we remain at your disposal for any technical support.

Best Regards.

MV AGUSTA MOTOR S.p.A.
Technical Service Support