

10/21/15

MY15 WK WD

GPOP - Issue Review System

Part Number: 68166105A\$

Part Description: ATX Shifter

Issue Description: Prior to removing (or disconnecting) the automatic transmission shifter knob, for any service to the shifter or for console removal, disconnect and isolate the battery negative cable. Wait two minutes for the system capacitor to discharge before further service. This will prevent a P1C86-14 DTC being stored in the electronic shift module (ESM). Failure to disconnect the battery before servicing the shifter may cause the P1C86-14 DTC to be set again. Clear the code before replacing the shifter. In the event a P1C86-14 DTC persist after following the above procedure, refer to 28 - DTC-Based Diagnostics, in the service manual.

~
Contact Us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. DO NOT email regarding repair procedures unrelated to this Tech Tip or part order inquires. Please include the Part Number (s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.
~