

9003214

02/11/2015

MY15

UF

GPOP - Issue Review System

Part Number: 68145494A\$

Part Description: Heated Backlight

Issue Description: By design, the upper 12 inches of the backlight does not defrost on vehicles built prior to MDH 121500. However, for improved clearance with 3 additional inches, the backlight can be replaced with p/n 68145494AF.

~
Contact Us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. DO NOT email regarding repair procedures unrelated to this Tech Tip or part order inquires. Please include the Part Number (s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.