



Service Bulletin

File In Section: 08 - Body and Accessories

Bulletin No.: 08-08-57-003B

Date: July, 2009

TECHNICAL

Subject: Floor Wet Under Carpet/Engine Continues to Run with Key Off/Possible No Crank/No Start/Communication Loss/Various Electrical Concerns (Seal Seam)

Models: 2008 Buick Enclave
2007–2008 GMC Acadia
2007–2008 Saturn OUTLOOK

This bulletin is being revised to add Correction information. Please discard Corporate Bulletin Number 08-08-57-003A (Section 08 — Body and Accessories).

Condition

- Right front floor is wet under carpet.
- A leak on the IP BEC could cause various electrical concerns such as: Engine Continues to Run with Key Off/Possible No Crank/No Start/Communication Loss/Various Electrical Concerns.
- This leak may also cause some communication issues between certain electrical modules due to water dripping on the IP BEC.

Cause




2125552

Water from the right front sunroof drain hose exits the vehicle through the plenum (upper arrow) and may re-enter through the un-sealed seam at the front of the dash. Refer to lower arrow in the illustration.

Correction

Important: Inspect the front drain hoses to ensure that they are free of clogs or kinks, and that water is properly flowing through the hoses.

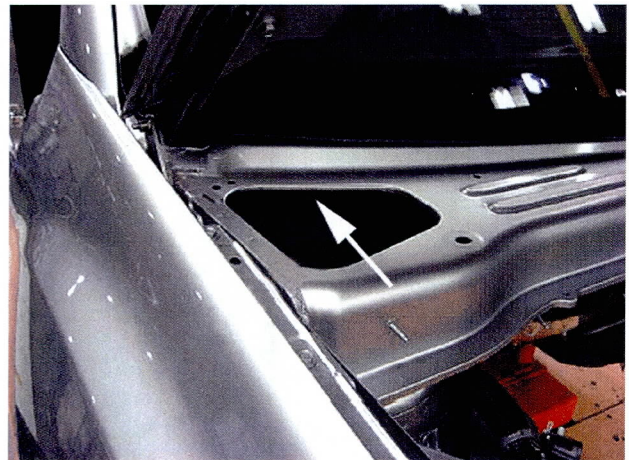


2125557

1. Remove the windshield wipers and cowl screen where sealing repair is to be done.

Important: Inspect the IP BEC for wetness and/or any green colored corrosion.

2. In order to verify the waterleak, run a small amount of water into the square hole inside the cowl while looking at the IP BEC.
3. Allow the water to dry and proceed to step 4.

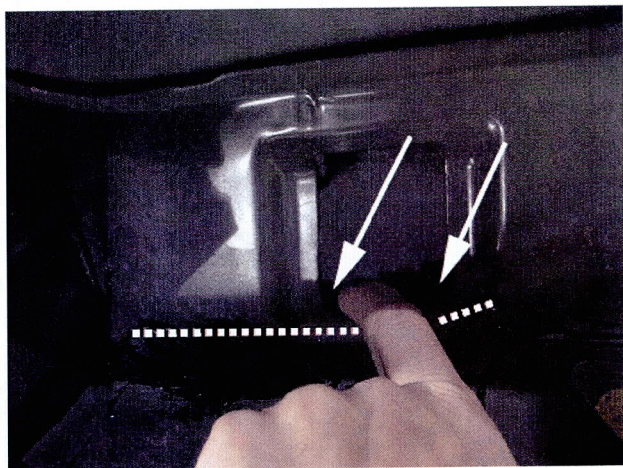

2125558

4. Seal the seam **INSIDE** the opening at the bottom and to the right and left of the arrows in the illustration. Seal the full length of the dotted line. Seal the seam with P/N 12378500 (in Canada, use 10952233) Medium Body Seam Sealing Compound or equivalent.

Parts Information

Part Number	Description
12378500 (in Canada, use P/N 10952233)	Medium Body Seam Sealing Compound

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
C0010*	Cowl Area – Reseal	0.1-0.4 hr

*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.

