

File In Section: Service Bulletin

Bulletin No.: PIT4898

Date: August, 2009

## PRELIMINARY INFORMATION

**Subject:** The SIR Light Is On With DTC's


**Models:** 2010 Chevrolet Equinox

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

**Condition/Concern:**

Some customers may complain that the driver's power seat is inoperative and/or the SIR light is coming on intermittently. When diagnosing the vehicle, DTC's B0014 and/or B0015 may be found in the SDM. The "PWR SEAT LT" fuse may be open in the underhood fuse block. This may be caused by a wire harness getting pinched under the driver's seat, between the seat frame and the power seat motor. This concern happens when the seat is moved to the up position.

**Recommendation/Instructions:**

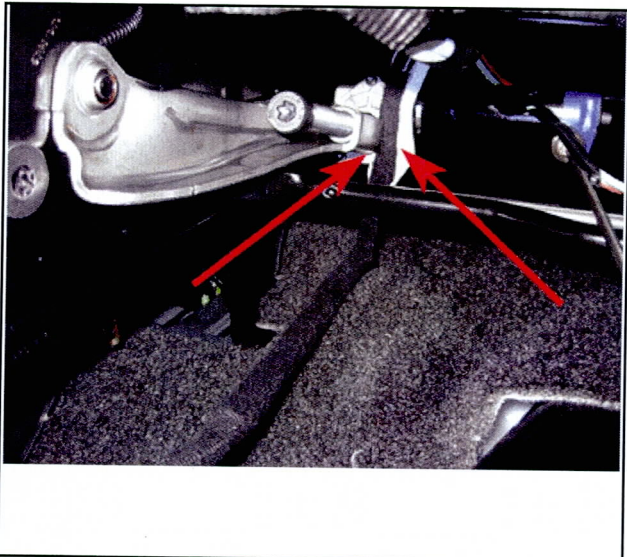

2321545

Check the wire harness under the seat for contact between the seat frame and the power seat motor (See picture above). The picture above is looking from the back of the seat, looking forward near the left seat track. If any wires are found to be damaged, repair them as necessary and reroute the wire harness to prevent any further contact.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.