

SB-10040845-6100

SI B11 07 11
Engine

July 2011
Technical Service

SUBJECT

Turbocharger Failure: Oil Supply Line Blockage

MODEL

All

SITUATION

The customer complains of loss of performance and turbocharger noise.

CAUSE

The turbocharger oil supply may be restricted, causing oil starvation and resulting in the seizing of the turbocharger assembly.

PROCEDURE

Upon replacement of the turbocharger assembly, always remove and inspect the oil supply lines for blockage or restriction. Ensure that the lines are not collapsed or kinked. Replace the lines if a blockage or restriction is detected. Inspection of the oil supply lines will avoid repeated failure of the turbocharger assembly.

WARRANTY INFORMATION

This service information bulletin is intended to provide technical diagnostic and/or repair information only.

If a warranty claim results from the above repairs, it should be submitted following the regular warranty claim procedures..

[Copyright © 2011 BMW of North America, LLC]