



Service Bulletin

File in Section: -

Bulletin No.: PI0699A

Date: April, 2012

PRELIMINARY INFORMATION


Subject: Gauge Fluctuation, Various DTCs, Wiring Harness Chafing/Rubbing on A/C Line

Models: 2011-2012 Chevrolet Silverado
2011-2012 GMC Sierra
Equipped with 6.6L Duramax™ Diesel Engine (RPO LML)

This PI is being revised to add additional DTCs. Please discard PI0699.

Condition/Concern



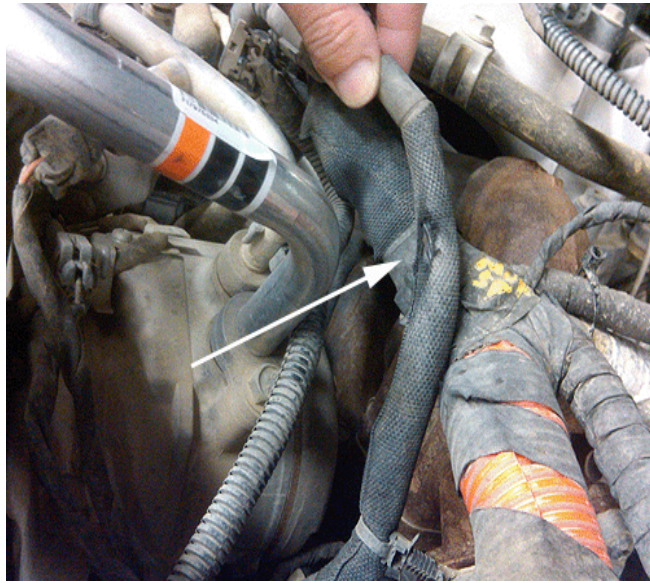

2787005

Some customers may comment that the oil pressure, oil level and/or the coolant temperature gauge fluctuates. Technicians may find one or more of the following DTCs set: P0193, P0341, P0521, P0522, P0523, P0641, P125A, P125B, P128E, P2294, P2295, P2296, P00CA, P0090, P00CA, P0091, P0092, P0087, P0088, P0182, P0183, P1088.

The engine wiring harness may be rubbing on the A/C line.

Recommendation/Instructions



2787007

Repair the wiring harness and install a tie strap to the area shown above.
Refer to SI for wiring repairs.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
N6653	Wire-to-Wire Repair	Use Published Labor Operation Time