



SB-10045319-5222

File in Section: -

Bulletin No.: PIC5692C

Date: August, 2015

Service Bulletin

PRELIMINARY INFORMATION

Subject: Brake Pedal Does Not Raise After Apply, Brakes Remain Applied Or Brake Lights On Unwanted

Models: 2010 - 2015 Buick LaCrosse
2011 - 2015 Buick Regal
2010 - 2015 Cadillac SRX
2013 - 2015 Cadillac XTS
2013 - 2015 Chevrolet Malibu

This PI was superseded to update Models and Model Years. Please discard PIC5692B.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

In rare cases, a customer or technician may comment the brake pedal may not raise or seem stuck down after a normal braking event. The condition may occur in high temperature and humidity conditions and may not be repeatable. Brake lights will remain on and brakes may drag after pedal released. A pop, click or snap noise may be heard when pedal is applied or released.

If concern is intermittent allow the vehicle to idle for 30 minutes on max heat and floor mode to try and induce the concern.

This condition may be due to a bind in the brake pedal pivot bushing.

Recommendation/Instructions

Replace the brake pedal arm.

Important: Be sure to use the two (2) new retaining clips that accompany the brake pedal arm.

To identify the correct brake pedal arm to order, please reference the Electronic Parts Catalog for the specific vehicle model and model year being serviced

Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
2441980	Brake Pedal Assembly Replacement	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.