

SB-10054087-5315



Countries:	CANADA, UNITED STATES	Document ID:	IK0800465
Availability:	ISIS, FleetISIS	Revision:	0
Major System:	ELECTRICAL SYSTEM	Created:	11/11/2013
Current Language:	English	Last Modified:	11/11/2013
Other Languages:	NONE	Author:	Chris Moody
Viewed:	131		

[Less Info](#)

Hide Details

Coding Information

Copy Link 	Copy Relative Link 	Bookmark View My Bookmarks	Add to Favorites 	Print 	Provide Feedback 	Helpful 7	Not Helpful 0
----------------------	-------------------------------	--	-----------------------------	------------------	-----------------------------	-------------------------	-----------------------------

Title: ProStar Deluxe with Ultrashift Shifter light flashes

Applies To: ProStar Deluxe

DESCRIPTION

ProStar Deluxe trim level with Ultrashift transmission will not have shift controls in the Steering wheel. The phoenix shifter is programmed to look for steering wheel mounted shift controls and if an error is detected, it will set a fault. If customer reports an LED on the shifter is flashing, check for codes and then follow the repair procedure below.

Fault Codes

- Other 3658:3 Voltage above normal or shorted to high source
- Other 3658:7 Mechanical system not responding or out of adjustment

Parts

15.8k ohm resistor-obtain locally

REPAIR PROCEDURE

The repair involves adding a resistor across the pins that would normally be from the steering wheel controls. Be sure to use best practices for this kind of repair including solder and heatshrink. Do not use butt connectors.

[Click Here](#)

Do not change any programming in the body controller.

Hide Details

Feedback Information

Viewed: 130
Helpful: 7
Not Helpful: 0
No Feedback Found