

SB-10054087-5467



Countries: BAHAMAS, BOLIVIA, BELIZE, CANADA, CHILE, TAIWAN, COLOMBIA, COSTA RICA, DOMINICAN REPUBLIC, ECUADOR, EL SALVADOR, TRINIDAD AND TOBAGO, UNITED STATES, URUGUAY, VENEZUELA, ARUBA, NICARAGUA, PERU, PUERTO RICO, Curaçao, GUAM, GUATEMALA, GUYANA, HAITI, HONDURAS, JAMAICA, KOREA, SOUTH KOREA, PANAMA

Document ID: IK0800465

Availability: ISIS, FleetSIS

Revision: 1

Major System: ELECTRICAL SYSTEM

Created: 11/11/2013

Current Language: English

Last Modified: 6/24/2015

Other Languages: NONE

Author: David Smith

Viewed: 510

[Less Info](#)

Hide Details

Coding Information

Copy Link 	Copy Relative Link 	Bookmark View My Bookmarks	Add to Favorites 	Print 	Provide Feedback 	Helpful 13	Not Helpful 1
----------------------	-------------------------------	--	-----------------------------	------------------	-----------------------------	--------------------------	-----------------------------

Title: ProStar Deluxe with Ultrashift Shifter light flashes

Applies To: ProStar Deluxe

CHANGE LOG

Please refer to the change log text box below for recent changes to this article:

6/24/2015 - Author updated for feedback purposes.

DESCRIPTION

ProStar Deluxe trim level with Ultrashift transmission will not have shift controls in the Steering wheel. The phoenix shifter is programmed to look for steering wheel mounted shift controls and if an error is detected, it will set a fault. If customer reports an LED on the shifter is flashing, check for codes and then follow the repair procedure below.

Fault Codes

Other 3658:3 Voltage above normal or shorted to high source
Other 3658:7 Mechanical system not responding or out of adjustment

Parts

15.8k ohm resistor-obtain locally

REPAIR PROCEDURE

The repair involves adding a resistor across the pins that would normally be from the steering wheel controls. Be sure to use best practices for this kind of repair including solder and heatshrink. Do not use butt connectors.

[Click Here](#)

Do not change any programming in the body controller.

Hide Details

Feedback Information

Viewed: 509
Helpful: 13
Not Helpful: 1

No Feedback Found

Copyright © 2015 Navistar, Inc.