

44853

2013-2015 Fusion/M KZ, 2015 Mustang and M KG-Reverse Park Aid Camera Active Gridlines Inoperative After Battery Disconnect or Component Service

Some 2013-2015 Fusion/MKZ, 2015 Mustang and MKC (Auto-Park only) equipped with a Reverse Park Aid Camera may have the Active Gridlines missing or inoperative after a battery disconnect, module disconnect, or module replacement that is associated with the Reverse Park Aid Camera system. Operation should return after the vehicle is driven straight on a flat/smooth road at 20 km/h (12 mph) or more with minimal steering input for 30 seconds. Abort this step at any time to maintain safe driving. Workshop Manual section 413-13 Pinpoint Test Y (Fusion), or Pinpoint Test D (Mustang, MKC, MKZ) have been updated with this information. If still inoperative, it may be necessary to disconnect the battery for 5 minutes with the driver's door open, then drive the vehicle for 5 miles in normal city driving before performing the above procedure.