

**NUMBER:** 23-027-15**GROUP:** Body**DATE:** June 20, 2015

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

THIS SERVICE BULLETIN IS ALSO BEING RELEASED AS RAPID RESPONSE TRANSMITTAL (RRT) 15-071. ALL APPLICABLE SOLD AND UN-SOLD RRT VIN's HAVE BEEN LOADED. TO VERIFY THAT THIS RRT SERVICE ACTION IS APPLICABLE TO THE VEHICLE, USE VIP OR PERFORM A VIN SEARCH IN TECHCONNECT. ALL REPAIRS ARE REIMBURSABLE WITHIN THE PROVISIONS OF WARRANTY.

SUBJECT:

Rear Door Rattle Noise

OVERVIEW:

This bulletin involves testing left rear door lower latch operation and if necessary, replacing the rear door center striker in addition to the upper and lower rear door latches.

MODELS:

2014	(VF)	Ram Pro Master (NAFTA)
------	------	---------------------------

SYMPTOM/CONDITION:

The customer may describe a rear door rattle noise and/or a rear door lower latch not working properly. An example of a properly functioning latch (1) and malfunctioning latch (2) are shown in ([Fig. 1](#)).

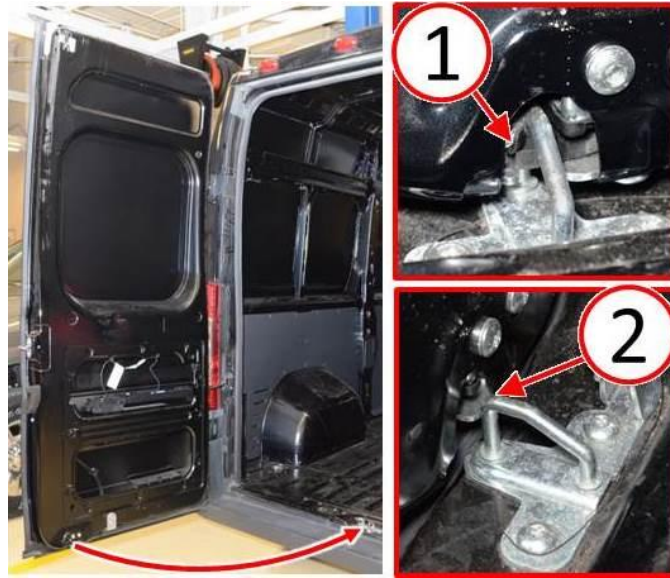


Fig. 1 Left Rear Door Lower Latch

1 - Proper Latch Operation - Latch Fully Engaged With Door Closed

2 - Latch Malfunction - Latch Not Engaged With Door Closed

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RRT VIN list, perform the repair. For all other customers that describe the symptom/condition, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
1 (AR)	68226085AB	Latch, Cargo Door, Left, Upper (Body 11, 12, 52) H1 Cargo Van
1 (AR)	68226086AB	Latch, Cargo Door, Right, Upper (Body 11, 12, 52) H1 Cargo Van
1 (AR)	68226087AB	Latch, Cargo Door, Left, Upper (Body 13,16,17, 26, 53, 56) H2 Cargo Van
1 (AR)	68226088AB	Latch, Cargo Door, Right, Upper (Body 13,16,17, 26, 53, 56) H2 Cargo Van
1	68226089AC	Latch, Cargo Door, Lower
1	68232446AA	Striker, Door, Latch, Center
2	68201888AA	Screw, Torx, M8x1.25x23, Striker To Door

REPAIR PROCEDURE:

1. Replace both right and left rear door upper latches. Refer to the detailed service procedures available in DealerCONNECT> TechCONNECT under: Service Info> 23 - Body> Doors - Rear> LATCH, Door, Rear Upper> Removal/Installation.
2. Replace the rear door lower latch. Refer to the detailed service procedures available in DealerCONNECT> TechCONNECT under: Service Info> 23 - Body> Doors - Rear> LATCH, Door, Rear Lower> Removal/Installation.
3. Replace the rear door center latch striker and fasteners. Refer to the detailed service procedures available in DealerCONNECT> TechCONNECT under: Service Info> 23 - Body> Doors - Rear> STRIKER, Door Latch> CENTER> Removal/Installation.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
23-41-01-9H	Replace Center Striker, Upper And Lower Latches (1 - Semi-Skilled)	6 - Electrical and Body Systems	0.8 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------