

## SB-10058083-7590

**FORD:**

2014-2015 Transit Connect

**ISSUE**

Some 2014-2015 Transit Connect vehicles built on or before 10/17/2014 may exhibit a fuel odor inside the cabin after refueling. This may be due to a distorted fuel tank filler pipe gasket and missing fuel tank filler pipe drain tube.

**ACTION**

Follow the Service Procedure steps to correct the condition.

**SERVICE PROCEDURE**

1. Remove the fuel tank filler pipe. Refer to Workshop Manual (WSM), Section 310-01.
2. Replace the filler pipe gasket and add a fuel filler pipe drain tube. (Figure 1A and 1B)

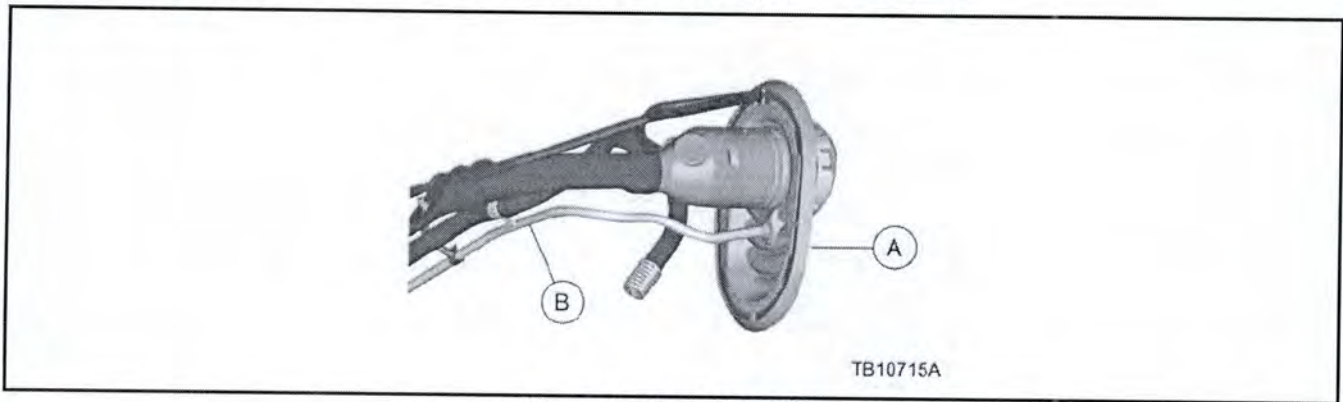


Figure 1 - Article 15-0087

3. Reverse procedure to install the fuel tank filler pipe and fuel filler door assembly.

| PART NUMBER   | PART NAME               |
|---------------|-------------------------|
| DT1Z-278A02-A | Fuel Filler Neck Gasket |
| BM5Z-9S303-A  | Drain Tube              |
| W714802-S300  | Clip                    |

| OPERATION | DESCRIPTION                                                                                                                                    | TIME     |
|-----------|------------------------------------------------------------------------------------------------------------------------------------------------|----------|
| 150087A   | 2014-2015 Transit Connect: Replace The Filler Pipe Gasket And Install Fuel Filler Pipe Drain Tube (Do Not Use With Any Other Labor Operations) | 1.1 Hrs. |

**WARRANTY STATUS:**

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage  
 Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

**DEALER CODING**

NOTE: The information contained in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supercede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.

| BASIC PART NO. | CONDITION CODE |
|----------------|----------------|
| 9S303          | 39             |