 
SB-10058141-5245

ATTENTION:

GENERAL MANAGER
PARTS MANAGER
CLAIMS PERSONNEL
SERVICE MANAGER

IMPORTANT - All Service Personnel Should Read and Initial in the boxes provided, right.



© 2015 Subaru of America, Inc. All rights reserved.

QUALITY DRIVEN® SERVICE

SERVICE BULLETIN

APPLICABILITY: 2015MY Legacy and Outback Models with

NUMBER: 07-90-15

Subaru Rear Vehicle Detection (SRVD) System

DATE: 04/22/15

SUBJECT: DTC B2350 for SRVD System

INTRODUCTION

This bulletin provides a new repair procedure for when the SRVD warning lamp is illuminated and DTC B2350 is stored in memory. The cause has been identified as a communication error between the SRVD radar units and the CAN transceiver triggered by a voltage drop which occurs during engine cranking.

COUNTERMEASURE IN PRODUCTION:

New radar assemblies have been incorporated into production starting with the following VINs:

Legacy: F3062279

Outback: F3328383

PART INFORMATION:

PART NUMBER	DESCRIPTION	
87611AL00B	RADAR AY BACK AND SIDE	

The radar assembly part number is the same for both left and right-hand units.

SERVICE PROCEDURE / INFORMATION:

Follow the Service Manual diagnostic procedure for B2350. Once the related harness and connector checks have been completed and all are confirmed to be OK, replace BOTH SRVD system radar sensors as a set following the procedure outlined in the applicable Service Manual.

Continued...

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

SUBARU OF AMERICA, INC. IS ISO 14001 COMPLIANT

ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

Bulletin Number: 07-90-15 Date: 04/22/15

Page 1

WARRANTY / CLAIM INFORMATION

For vehicles within the Basic New Car Limited Warranty period or covered by a Subaru Added Security (SAS) Gold / Gold Plus plan, this repair may be claimed using the following information:

LABOR DESCRIPTION	LABOR OPERATION #	FAIL CODE	LABOR TIME
SRVD UNIT BOTH (MASTER & SLAVE UNITS) R&R	B067-804		0.6
SUBARU REAR VEHICLE DETECTION SYSTEM DIAGNOSIS	C067-800	ZQJ-43	0.4
SRVD TARGET POSITION ADJUSTMENT BOTH SIDES	C067-838		0.8

REMINDER: SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.

Always refer to STIS for the latest service information before performing any repairs.

Bulletin Number: 07-90-15 Date: 04/22/15