

**ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM
FOR MARCH 2015**

45012 2013-2015 Fusion/MKZ, 2015 MKC, 2015 Mustang - Steering Column Controls
Inoperative With Possible U0212 - Built On Or Before 3/20/2015

Some 2013-2015 Fusion/MKZs, 2015 MKCs, or 2015 Mustangs may exhibit the steering column controls such as turn signals, radio controls, and low speed wipers being intermittently inoperative with a possible U0212 in multiple modules. First, correct any HS2 CAN network issues that may be present if various other HS2 CAN U-codes are present. If no network issue is present and the vehicle is built on or before 3/20/2015, reprogram the SCCM to the latest calibration using IDS release 94.04 and higher. Remove and reinstall fuse F13 if the SCCM will not communicate in order to accept the calibration update. Replace the SCCM if communication with the module can't be restored. Use applicable 12651D labor ops and causal part 3F791 for reflash only.