

Service Campaign Bulletin

SB-10058274-5382



Mercedes-Benz

Campaign No. 2015030003, March 2015

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Model 205 (C-Class), Model Year 2015**
Update Engine Control Module Software

This Service Campaign has been initiated because Daimler AG (DAG), the manufacturer of Mercedes-Benz vehicles, has determined that the software in the engine control module does not meet specifications. It is therefore possible that a communication error may occur between the engine control unit and the ESP control unit. This communication error may result in fast torque control via ignition angle not being possible. To correct this condition dealers will update the engine control module software at the next dealer visit.

Prior to performing this Service Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Service Campaign bulletin and follow the repair procedure exactly as described.

Approximately 5 vehicles are affected.

Order No. P-SC-2015030003

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Service Campaign Bulletin

Service Campaign Bulletin

 
Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Procedure

i Note:

- Use DAS/Xentry 12/2014-01-02/2015 with all associated patches or higher.
 - Follow the steps exactly as described in DAS/Xentry.
 - Connect battery charger (battery voltage  >12.5V).
 - Ensure all electrical consumers are switched-off.
 - In the event of software/SCN update issues, contact Star Diagnosis User Help Desk. Please refer to the "pre-call" check list before contacting UHD
 - Refer to Star Diagnosis System (SDS) Best Practices Guide.
1. Update software for MEG 17.7 control module:
Control units / Drive / MEG 17.7 / Control unit adaptations / Control unit programming.
 2. Follow on-screen instructions.

i Note:

Please verify ME software number change after performing the software update.

Warranty Information

Operation: Connect/disconnect battery charger (02-5058)
Star Diagnosis System (SDS), Connect/disconnect (02-4762)
Update software for engine control module (02-8857)

Damage Code	Operation Number	Labor Time (hrs.)
54 983 46 8	02-5058	0.1
	02-4762	0.1
	02-8857	0.1

i Note

Operation Number labor times are subject to change.