

Service Campaign Bulletin

SB-10058275-3454



Mercedes-Benz

Campaign No. 2015040005, May 2015

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Model 205, Model Year 2015**
Install Spacer Ring at Coolant Line

Daimler AG (DAG), the manufacturer of Mercedes-Benz vehicles, has determined that the coolant line may not correspond to the current series production configuration. The coolant line may chafe at the air intake pipe which may lead to leaks at the cooling system. To correct this condition an authorized Mercedes-Benz dealer will install a spacer ring on the coolant line at the next dealer visit.

Prior to performing this Service Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Service Campaign bulletin and follow the repair procedure exactly as described.

Approximately 3038 vehicles are affected.

Order No. P-SC-2015040005

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Service Campaign Bulletin


Service Campaign Bulletin

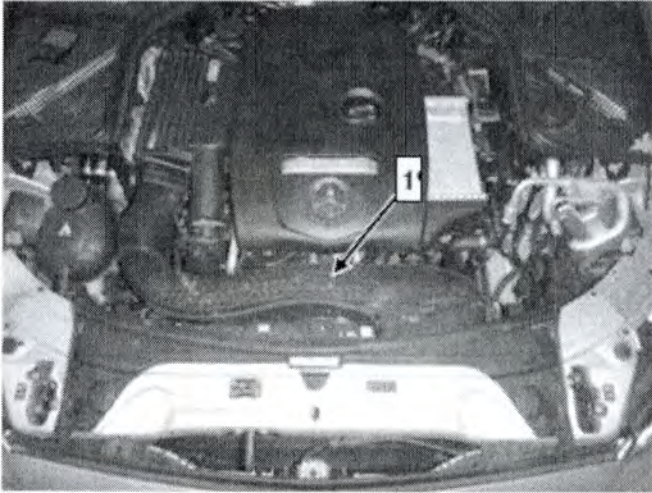
Service Campaign Bulletin


Service Campaign Bulletin

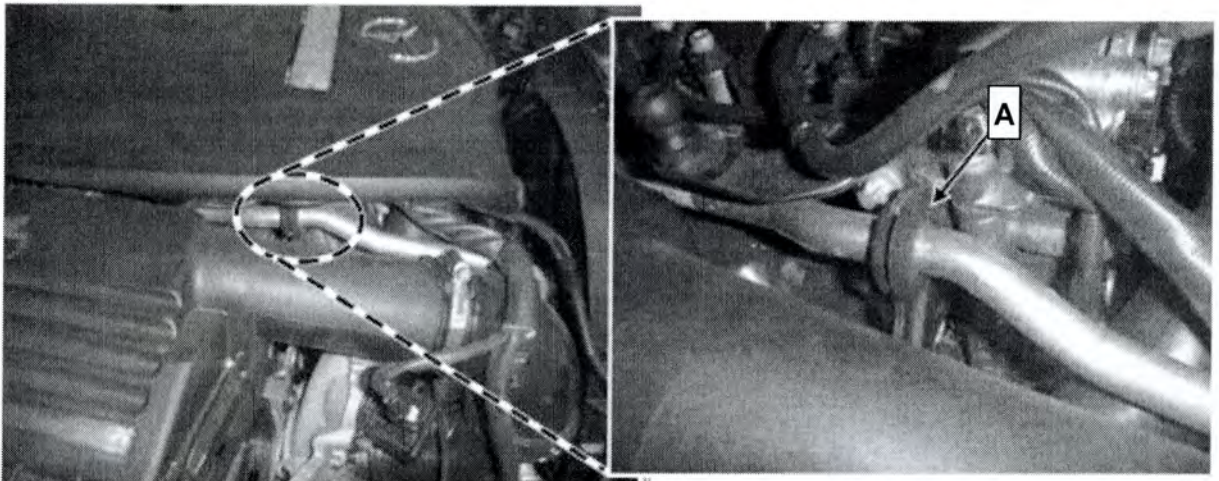
Service Campaign Bulletin



Procedure

1.  Remove engine air intake duct (1, Figure 1) upstream of air filter.

**Figure 1**

2.  Press rubber grommet (A, Figure 2) out of bracket.

**Figure 2**

3.  Install spacer ring (B, Figure 2) on metal coolant line.
 The lock of the spacer ring (B) should point in the direction of travel (towards the front).

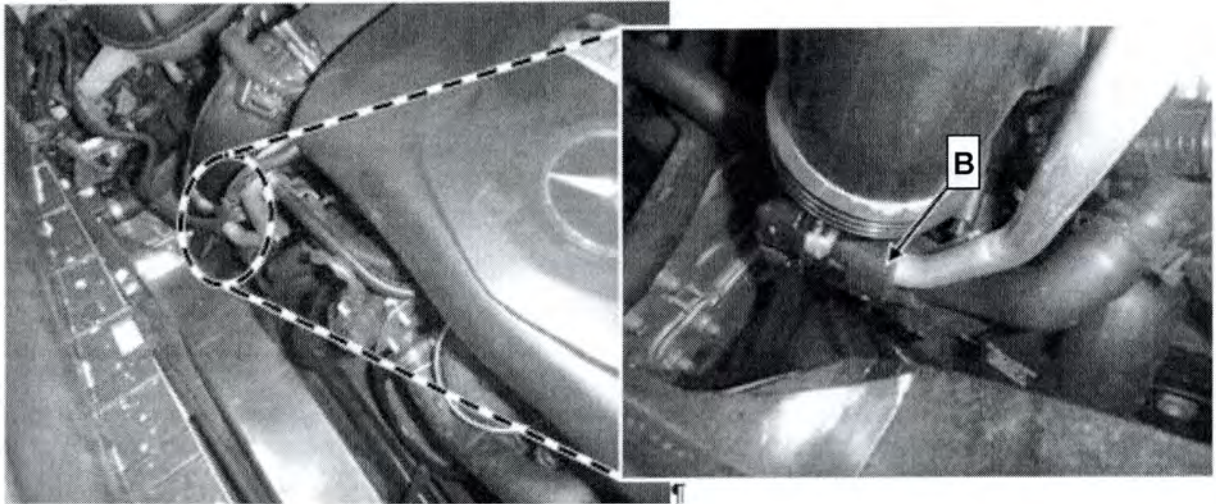




Figure 3

4.  Press rubber grommet (A, Figure 2) back into bracket again.
 The rubber grommet (A) must be seated correctly in the bracket.
5. Reassemble in reverse order.

Primary Parts Information

Qty.	Part Name	Part Number	Estimated Replacement Rate
1	Spacer ring	A 000 997 93 44	100%

i Note:

- Please be aware that only the part number(s) referenced in the Campaign Bulletin is/are approved for use to repair the vehicle. Repairs performed using any other part(s) will not have been performed in accordance with the campaign. Accordingly, warranty claims submitted with reference to an improper part number(s) will be denied.
- The following allowable labor operation should be used when submitting a warranty claim for this repair:

Warranty Information

Operation: Install spacer ring at coolant line (02-8983).

Damage Code	Operation Number	Labor Time (hrs.)
20 940 35 7	02-8983	0.2

i Note

Operation Number labor times are subject to change.