

XENTRY

Driver door cannot be opened from outside

Topic number	LI80.20-P-061495
Version	1
Design group	80.20 Central locking system
Date	05-22-2015
Validity	C453 smart fortwo
Reason for change	
Reason for block	

Complaint:

When it is unlocked via the radio remote control of the central locking, the driver door cannot be opened from outside. Once opened from the inside, the door can then be opened from the outside again.

Cause:

Incorrect routing of the Bowden cables can result in one of the cables kinking and jamming. (See Figure 1).

Attachments	
File	Description
Bild 1.jpg	Incorrect cable routing

Remedy:

Replace the cables together with the lock and make sure that the cables are routed correctly. The cables must cross underneath the door handle, as shown in Figure 2.

Attachments	
File	Description
Bild 2.jpg	Correct cable routing

Symptoms
Body / Door/Flap / Door / Door handle / Jammed

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 453 720 13 00				1		X

Work units				
Op. no.	Operation text	Time	Damage code	Note
72-6772		13 AW	72A24 H2	

WIS-References			
Document number	Title	Note	Allocation
AR72.10-P-4011SRA	Türschloss Vordertür aus-, einbauen		Remedy

Validity		
Vehicle	Engine	Transmission
453.341	*	*
453.342	*	*
453.344	*	*

Full model designation breakdown		
Vehicle	Engine	Transmission
453.341	281.920	700.121
453.341	281.920	700.410
453.342	281.920	700.121
453.342	281.920	700.410
453.344	281.910	700.122
453.344	281.910	700.411

Attachments

Bild 1.jpg:

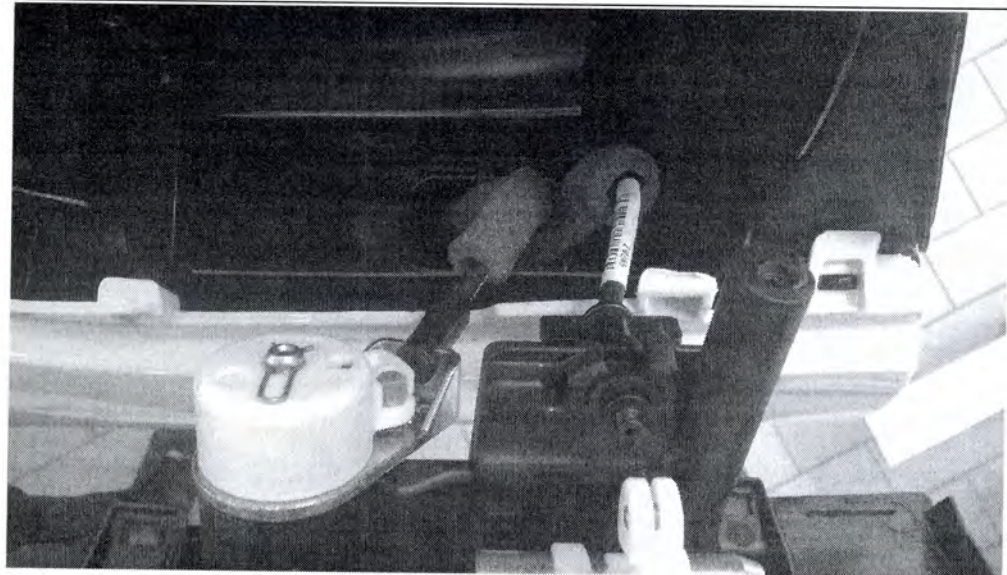


Bild 2.jpg:

