



NUMBER: 08-035-15 REV. B

GROUP: Electrical

DATE: August 04, 2015

SB-10058297-8367

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

THIS BULLETIN SUPERSEDES TECHNICAL SERVICE BULLETIN 08-035-15 REV. A, DATED JULY 16, 2015, WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH **ASTERISKS INCLUDES UPDATING SYMPTOM/CONDITIONS AND UPDATING REPAIR PROCEDURE.**

SUBJECT:

RA3 RA4 Radio Enhancements

OVERVIEW:

This bulletin involves inspecting and if required, updating the radio software.

MODELS:

2015 (UF) Chrysler 200

NOTE: This bulletin applies to vehicles within the following markets/countries, NAFTA.

NOTE: This bulletin applies to vehicles equipped with one of the following radios:

- Uconnect 8.4A AM/FM/BT/ACCESS (sales code RA3)
- Uconnect 8.4AN AM/FM/BT/ACCESS/NAV (sales code RA4)

SYMPTOM/CONDITION:

A customers may experience one or more of the following:

- Rearview Camera image appears jittery.
- Inability to establish a WiFi connection when security feature is enabled.
- Audio distortion/popping heard while playing Apple devices through the USB port.
- Remote Uconnect Apps functions (i.e. door locks, remote start) inoperative while the engine is running.
- The Radio may switch from SiriusXM to an AM station by itself.
- Uconnect registration always present, can not remove Uconnect account.
- Teleprompter does not appear when pressing the Voice Recognition (VR) button.
- VR operation cancels while in media mode.
- Radio may display previous cameras image before displaying the current image.
- Navigation lost vehicle position, during route calculation.
- Navigation displays are missing after vehicle heading changes.
- Navigation giving incorrect guidance to exit the highway.
- FM audio may switch to AM after ignition cycle.
- Text messages appear as sender's phone number not their name.

- VR phone button may not work at times.
- Audio muted after AUX device is disconnected.
- VR, “ Listen” to text, will only play 1st message.
- SiriusXM station information does not update.
- Speed adjusted volume, may not work.
- AM or FM seek or tuner soft keys may be missing.
- Display screen show ambient temperature as ”- - “ not normal values.

Improvements:

- Faster response time when using the Remote Service App (US market only).
- Faster connection time with 911 (US market only).
- Navigation system improvements.
- Enable High Definition (HD) feature, (RA4 radios located in Canada and Mexico).
- Keyboard improvements, in the Points Of Interest (POI) section.
- High Definition (HD) radio buffering.
- Spanish translation.
- Radio station, scroll feature.
- Making assist calls.
- App functionality and screen displays.
- Displays correct media, song titles and tracks.
- Travel Link, Points Of Interest (POI), displaying movies and favorites.
- Audio for strong AM stations.
- VR performance.
- Settings can only be changed in run mode, not ACC.
- Notify user when messaging features are not supported on certain phones/devices.
- Shows direction and distance for POI when using VR.

DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available, verify all vehicle systems are functioning correctly. If any DTCs are present, record them on the repair order and repair as necessary before proceeding further with this bulletin.

If a customer describes the symptom/condition above, perform the Repair Procedure.

REPAIR PROCEDURE:

CAUTION: This software update is only compatible with the 2015 model year vehicles listed above. Attempting to flash a 2013-2014 model year vehicle with this software will result in a loss of some radio/navigation functions. Should this occur reinstalling the correct software for the radio will correct the condition.

1. Has the USB stick been created?
 - a. Yes >>> Proceed to [Step #5](#).
 - b. No >>> Proceed to [Step #2](#).
2. Go to DealerCONNECT> Service> UCONNECT Information & Utilities> Uconnect Dealer software downloads to download the files.
3. If a security message appears “Do you want to view only the web page content that was delivered securely?” see ([Fig. 1](#)). Press **No** to continue.

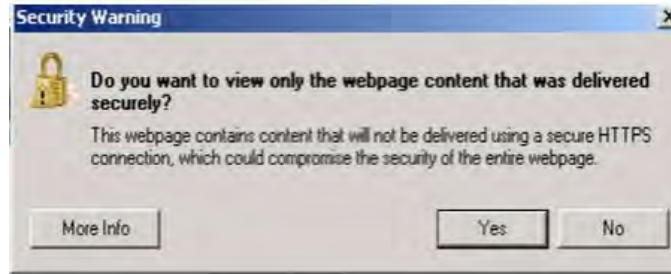


Fig. 1 Pop-up Security Message

NOTE: A blank USB stick must be used to download the software. Only one software update can be used on one USB stick.

NOTE: If the dealer cannot download the software, make sure you have proper security access. If not, have the Service Manager or Shop Foreman download the software update.

4. To download the software files to a USB stick, follow the on screen instructions and perform the following.
 - a. Acquire a blank USB stick with at least 4 GB of space.
 - b. Download the software update file to your local pc's desktop.
 - c. Be sure to extract the file before copying it to the blank USB stick.
 - d. A blank USB stick will be needed one for each radio update, additional updates can not be on the same USB stick.
 - e. Once the file is saved to the USB stick, label it with the bulletin number and proper radio sales codes.
5. With the engine running and radio powered on, insert the **correct** USB stick with new software into USB port.
6. The next screen display will have the old and new software levels. The radio will be updated to 15.17.5.
7. Is the current radio software version 15.17.5 or higher?
 - a. Yes>>> The radio software is already up to date. The bulletin is complete.
 - b. No>>> The radio software needs to be updated. Proceed to [Step #8](#).

CAUTION: If the radio software level is at or above the level on the USB stick, DO NOT perform the update.

8. Press the soft key “Yes” to start the update.

NOTE: If the software update process is interrupted, aborted or failed, the process should be restarted.

NOTE: Do not cycle the ignition or touch the radio during the update process.

9. The update may take up to 20 minutes to load. No other actions will be needed to initiate the update.
10. After the update is done, the screen will display the software levels again.
11. Press “No” and turn the vehicle off. Open and close the driver’s door and let the Bus go to sleep.

NOTE: Make sure to leave ignition off, do not press the brake, and do not reopen any doors, so the modules will go to sleep.

12. Cycle the ignition on, then back off one more time. Open and close the driver’s door and let the Bus go to sleep. This will complete the radio update.
13. Remove the USB stick.
14. ****Does the vehicle have Blind Spot Monitor/Cross Path Detection (Sales Code XAN)?**
 - a. Yes >>> Proceed to [Step #15](#)
 - b. No >>> This bulletin has been completed.**
15. ****Go into the radio Settings menu and select Safety & Driving Assistance. Locate the Blind Spot Alert feature and turn on the “Lights + Chimes” option.****
16. This bulletin has been completed.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
18-60-02-FS	Radio, Check Software Level and, Perform Software Update (0 - Introduction)	6 - Electrical and Body Systems	0.4 Hrs.
18-60-02-FT	Radio, Software - Create USB flash drive, Uconnect Website (One Time Only) (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs

NOTE: The “One Time Only” LOP is used one time per dealer when downloading the software onto a USB stick. The dealer can only use the download LOP, one time for each of the radios.

NOTE: The expected completion time for the flash download portion of this procedure is approximately 20 minutes. Actual flash download times may be affected by vehicle connection and network capabilities.

FAILURE CODE:

The dealer must choose which failure code to use. If the customer came in with an issue and the dealer found updated software to correct that issue, use failure code CC, for all other use failure code RF.

- If the customer’s concern matches the SYMPTOM/CONDITION identified in the Service Bulletin, than failure code CC is to be used.
- If an available flash is completed while addressing a different customer concern, failure code RF is to be used.

CC	Customer Concern
RF	Routine Flash