

SB-10058428-5514

Reference	SSM72329
Models	XE / X760
Title	Banjo Bolt Fixings weeping.
Category	Chassis
Last modified	09-Jul-2015 00:00:00
Symptom	301000 Service Brake System
Attachments	Copper Washer.JPG Tin Washer.JPG

Content**Issue:**

The banjo joint on the brake calliper to brake hose may have a minor weep or show signs of dampness. This affects VIN range SAJAB4AN0GA900466 to SAJAB4AG5GA905809.

Cause:

There has been some instances where the joint has shown signs of torque relaxation resulting in minor seal leakage.

Action:

- Confirm area shows signs of leakage.
- Confirm two copper washers are fitted (one either side of the hose as per image 1) - if non copper washers are fitted (as per image 2) or no washers are fitted then a replacement hose is required.
- If copper washers are fitted then using a suitable torque wrench tighten the joints to 47Nm.
- Once tightened pump the brake pedal 5 times holding it fully depressed for 10 seconds on the final pump.
- Confirm no leakage is present - release car to customer.
- If leakage is present - replace hose and submit ePQR.

NOTE - 47Nm is only applicable to vehicles fitted / being fitted with hoses that have copper washers.