

SB-10058445-5139

ONLINE AUTOMOTIVE SERVICE INFORMATION FOR MAY 2015

45124 2013-2016 Lincoln MKZ Equipped With Power Decklid - Intermittent Battery Draw Or Intermittently Inoperative Power Decklid - RGTM Software Update

Some 2013-2016 Lincoln MKZs equipped with a power decklid may exhibit an intermittently inoperative power decklid, an intermittent bounce back condition, or an intermittent battery draw that can be isolated to the Rear Gate Trunk Module(RGTM). To correct the concern, reflash the RGTM to the latest calibration using IDS version 95.03 or higher. Make sure you are connected to the internet when entering module programming to obtain the latest updates. Calibration files may also be obtained at www.motorcraftservice.com. Use causal component 14B291 and applicable 12651D labor operations from Section 10 of the SLTS manual for reflash only.