

**SB-10058455-3978**  
**ONLINE AUTOMOTIVE SERVICE INFORMATION**  
**FOR MAY 2015**

45134 2011 - 2015 Fiesta - Issues Configuring Instrument Panel Cluster (IPC)

Some 2011-2015 Fiesta vehicles may exhibit various reconfiguring issues following Instrument Panel Cluster (IPC) replacement including odometer displaying incorrect English or Metric units and/or U2101 DTC in multiple modules. If Programmable Module Installation (PMI) has been performed on the replacement IPC, disconnect the IPC, start a new IDS session and perform a PMI on the IPC. Do not reconnect the IPC until after the IDS states it is unable to communicate with the IPC, then allow the PMI process to complete. This will automatically load the correct configuration and address any related DTCs or symptoms.