

SB-10058463-6312

ONLINE AUTOMOTIVE SERVICE INFORMATION FOR MAY 2015

45147 2010-2012 Fusion, Milan, MKZ - Illuminated Malfunction Indicator Lamp (MIL) With DTC P0A7E:00 - Hybrid Battery Pack Over Temperature

Some 2010-2011 Milan, and 2010-2012 Fusion and MKZ Hybrid vehicles may exhibit an illuminated Malfunction Indicator Lamp (MIL), and/or a Stop Safely Now message in extreme hot ambient temperatures coupled with diagnostic trouble code P0A7E:00 present in the Battery Energy Control Module (BECM). Refer to WSM section 414-03 to diagnose the P0A7E concern. Under extreme hot weather, if diagnosis leads to BECM replacement, reprogram the BECM, also reprogram the PCM and TCM (if available), to the latest calibration using IDS release 95.04 and higher. Do not replace the BECM or the high voltage battery. The calibration raises the overheat threshold to address extreme hot weather operation. Use applicable 12651D labor operations from section 10 of the SLTS manual and causal part 10B687 for reflash only.