



SI M11 05 15
Engine

SB-10058469-3344

June 2015
Technical Service

SUBJECT

Service Action: Replace Oil Filter Housing Assembly

MODEL

F55 (Cooper S)

With B46 engine

F56 (Cooper)

With B38 engine

F56 (Cooper S)

With B48 engine

SITUATION

A coolant leak could occur at the oil filter housing, resulting in overheating, loss of power, and an engine warning light.

AFFECTED VEHICLES

This Service Action involves F55 and F56 models (MINI Cooper and Cooper S) produced from 1/2014 to 11/2014.

Vehicles which require this Service Action to be completed will show it as "Open" when checked either in the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

PROCEDURE

For vehicles that are still in dealer inventory, replace the oil filter housing assembly by performing the attached step-by-step procedure.

For vehicles that have already been delivered to Motorers, please call them and invite them back to the dealership so that their MINIs can be repaired. When the Motorers bring their MINIs to your dealership, please provide them with a MINI service loaner from your AMP fleet.

PARTS INFORMATION

Part Number	Description	Quantity
11 42 8 590 022	Oil filter housing assembly	1

Bulk Materials

Part Number	Description	Quantity
82 14 0 031 133	Antifreeze (1 gallon = 2 gallons at 50/50 mix)	As required
83 21 2 365 947	Motor oil SAE 5W-30 Longlife	1 liter

WARRANTY INFORMATION

Reimbursement for this Service Action will be via normal claim entry utilizing the following information:

Defect Code:	00 11 61 03 00	
---------------------	-----------------------	--

Completion before vehicle delivery to the customer or the vehicle is already in the workshop

Labor Operation:	Labor Allowance:	Description:
00 62 993	Refer to KSD2	Replace oil filter housing assembly (Plus work)

Or:

Completion after vehicle delivery to the customer

Labor Operation:	Labor Allowance:	Description:
00 62 285	Refer to KSD2	Replace oil filter housing assembly (Main work)

And:

Sublet - Materials

Sublet Code 4	See sublet reimbursement calculation below	Reimbursement for repair-related materials (Do not use the MINI part numbers for claim submission)
---------------	--	--

Sublet reimbursement calculation for claiming used quantities of repair-related materials:

- MINI Antifreeze/Coolant (one-gallon container P/N 82 14 0 031 133) for the required refill quantity (50/50 mixture) at dealer net plus handling.
- MINI Motor Oil SAE 5W-30 Longlife (one liter, P/N 83 21 2 365 947) at dealer net plus handling.

Enter this material cost as one combined sublet amount, and itemize each in the claim comment section.

ATTACHMENTSView PDF attachment [M110515 Instructions](#).

[Copyright ©2015 BMW of North America, Inc.]