

Instrument cluster: Assistance graphic freezes

Topic number	LI54.30-P-061864
Version	1
Design group	54.30 Instrument cluster/display instruments/warning devices
Date	07-17-2015
Validity	Model 218 as of VIN *****A141977 up to VIN ***** **A148184 Model 212 as of VIN *****B085484 up to VIN ***** **B177229
Reason for change	
Reason for block	

Complaint:

The assistance graphic can freeze if a DISTRONIC speed is set and then immediately canceled.

Cause:

Instrument cluster software.

Remedy:

Perform control unit programming of instrument cluster (A1) with XENTRY Diagnostics 05/2015 or higher.

Do not remove/install or replace any parts.

Symptoms
Communication/information / Information display / Displays / Multifunction display / Multifunction display, menu / Not operable
Communication/information / Information display / Displays / Multifunction display / Multifunction display, error messages / Implausible messages despite properly functioning message systems
Communication/information / Information display / Displays / Speedometer digital / Incorrect display
Communication/information / Information display / Displays / Multifunction display / Multifunction display, menu / Faulty display

Work units				
Op. no.	Operation text	Time	Damage code	Note
54-0650	MAINTAIN BATTERY VOLTAGE (FOR TESTING AND DIAGNOSIS WORK)	1 AW		
54-1011	PERFORM QUICK TEST	3 AW		
54-0991	INSTRUMENT CLUSTER CONTROL UNIT: INSTALL SOFTWARE (AFTER QUICK TEST)	4 AW		

XENTRY

Validity		
Vehicle	Engine	Transmission
CLS (218)	*	*
E (212)	*	*