

SB-10058561-1223

Engine shuts off at 5 mph with Eco start stop.

Topic number	LI07.70-P-061851
Version	1
Design group	07.70 Direct injection gasoline injection and ignition system
Date	07-27-2015
Validity	MY14 and MY15 models 217/222 with M278 and SA code B03 Eco Start Stop.
Reason for change	
Reason for block	

Complaint:

Customer complains the engine shuts off at 5 mph and is restarted normally via Eco Start Stop.

Cause:

Mismatched software levels of MED177 and PTCU

Remedy:

Update the software for MED177 and PTCU to the latest version with Xentry 07/2015.

Symptoms
Power generation / Engine management / Engine running / Stalls/goes out
Power generation / Engine management / Engine performance / Cuts off

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
54-0650	12V		54575 90	
54-1011	QUICK TEST		54575 90	
54-0991	FLASH ME		54575 90	

Validity		
Vehicle	Engine	Transmission
217.385	*	*
222.184	*	*