


Technical BULLETIN

©2015 YAMAHA MOTOR CORPORATION, U.S.A.

CERTAIN 2015 YZF-R1F and YZF-R1MF MODELS Excessive Rear View Mirror Vibration


i INTRODUCTION

Problem: In certain units, the rider may notice excessive vibration of the rear view mirrors while riding.

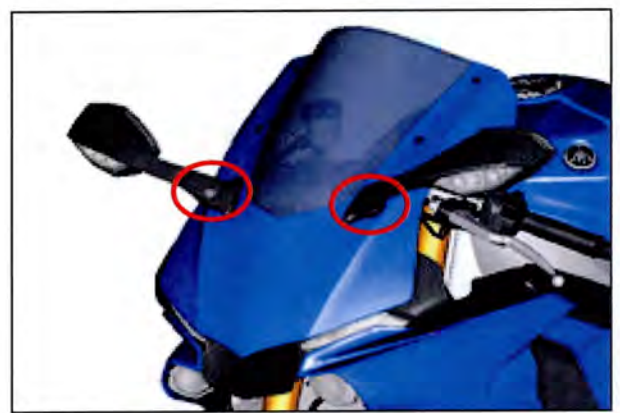

Cause: The spring washers that supply tension to the pivot points in the mirrors were installed incorrectly during manufacturing. Since tension is decreased in the pivot point of the mirror, free play occurs which results in vibration.

Remedy: On units within the affected range, replace the left and right side mirrors.

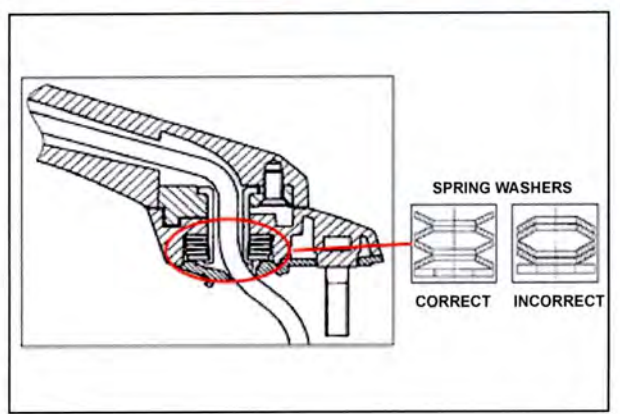

🚧 DEALER ACTION SUMMARY

Unsold Units: Modify all units in the applicable range after checking unit status on YDS to be sure the modification hasn't already been done. Follow the procedures listed in this bulletin to replace the unit's left and right side mirrors.

Sold Units: Modify all units in the applicable range after checking unit status on YDS to be sure the modification hasn't already been done. Follow the procedures listed in this bulletin to replace the unit's left and right side mirrors.

Parts Required: Yes, (refer to the *Parts Information* section for more details).

Warranty: Submit a Service-per-Bulletin (90 Code) Warranty Request for parts and labor reimbursement (refer to the *Warranty Information* section).



AFFECTED RANGE

YZF-R1F

RN39E-0000001; RN39E-0000005~0000018

RN39Y-0000009~0000018



YZF-R1MF

RN40E-0000002~0000021





SERVICE PROCEDURES

1. Remove the side panel covers and disconnect the turn signal coupler (1) for each side.

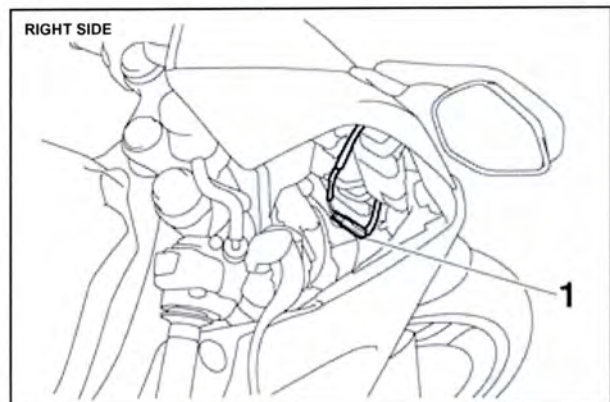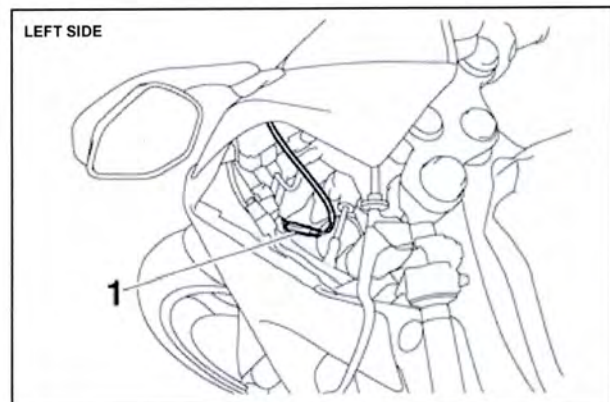

2. Remove the 2 nuts retaining each mirror and remove the mirror assembly.
3. Install the replacement mirror in the reverse order of disassembly.

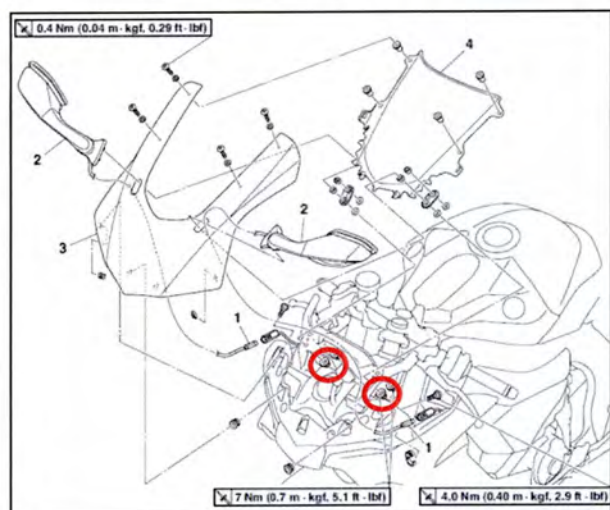

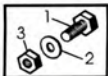

PARTS INFORMATION

Order the following parts:

Part Number	Description	Qty.	Dealer Cost
2CR-26280-10-00	Rear View Mirror Assy., Left	1	\$125.82
2CR-26290-10-00	Rear View Mirror Assy., Right	1	\$125.82



WARRANTY INFORMATION

Service of all affected units is authorized regardless of warranty status.

After completion, select Problem Code **090WP** from the Problem Code pull-down menu in the Yamaha Dealer System (YDS) when entering your claim. The labor allowance for this repair is **0.4 hour** to replace both mirrors.

This Service-per-Bulletin 90 Code (**90WP**) will only be **valid for 5 years** from date of issue of this Technical Bulletin and will expire 8/26/2020.

ROUTE TO: SERVICE PARTS WARRANTY SALES