

SB-10058602-7607

ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM FOR JULY 2015

45213 2015 Mustang - 107 mm (4.2 Inch) Front Control Driver Interface Module (FCDIM)
Blank Screen And No Audio With Ignition On - Built On Or Before 2/14/2015

Some 2015 Mustang vehicles built on or before 2/14/2015 with a 107 mm (4.2") Display may exhibit a blank FCDIM screen and no audio from the entertainment system with key on engine off or running. Reprogram the FCDIM to the latest calibration using IDS release 96.02 or higher. Make sure you are connected to the internet when entering module programming to obtain the latest updates. Calibration files may also be obtained at www.motorcraftservice.com. Use applicable 12651D labor operations from Section 10 of the SLTS manual.