

## **SB-10058632-1926**

### **ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM FOR JULY 2015**

45257 2015 F-Super Duty → No Reverse Or 2-3 Shift Shudder → Diagnostic Trouble Codes (DTC) P0757 And/Or P2700 - Built On 2/1/2015 And Through 3/31/2015

Some 2015 F-Super Duty vehicles equipped with a TorqShift6 transmission and built on 2/1/2015 and through 3/31/2015 may exhibit a no reverse concern and/or a 2-3 shift shudder with or without DTC P0757 and/or P2700. These symptoms may be due to the 3 Teflon seals on the stator support wearing prematurely because of rough finish of the stator support seal grooves. If the 3 Teflon seals appear to be worn replace the 7A103 pump assembly as part of the transmission repair. Use applicable labor operations from Section 7 of the Service Labor Time Standards (SLTS) manual.