

SB-10058663-3666

45313 2015 Escape - Digital Speedometer Inoperative/Missing After Instrument Cluster Panel (ICP) Module Reprogramming Between 6/24/15 And 7/16/15

Some 2015 Escape vehicles may exhibit an inoperative/missing digital speedometer if ICP module reprogramming was performed between the dates of 6/24/2015 and 7/16/2015. To correct this condition connect the Integrated Diagnostic System (IDS) and use the following procedure. Select Module Programming > Programmable Parameters > Car Configuration Parameters > Vehicle Configuration > Retrieve PTS derived ASBUILT data using an IDS at 96.02 or higher ensuring that the laptop is connected to the internet.