

**NUMBER:** 09-011-15**GROUP:** Engine**DATE:** September 19, 2015

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

SUBJECT:

Incorrect 6.4L Engine Oil Dipstick

OVERVIEW:

This bulletin involves installing the correct engine oil indicator (Dipstick).

MODELS:

2015 (WK) Jeep Grand Cherokee

NOTE: This bulletin applies to vehicles built on or before June 12, 2015 (MDH 0612XX) equipped with 6.4L Engine (Sales Codes ESG).

SYMPTOM/CONDITION:

The customer and/or technician may notice after performing an oil change the Dipstick may indicate the oil was over filled. When changing the oil and filter, service information shows 7 quarts are required. After installing 7 quarts the Dipstick may indicate the engine is over filled by 1 quart.

DIAGNOSIS:

If the customer describes the symptom/condition listed above, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
1	05038472AB	Indicator, Engine Oil Level (Dipstick)

REPAIR PROCEDURE:

1. Remove the Dipstick from the tube and look for the part number.



Fig. 1 Location Of The Part Number On The Dipstick

-
2. Is part number 05038472**AA** on the Dipstick?
 - a. Yes >>> Replace the Dipstick with part number 05038472**AB**.
 - b. No >>> This bulletin does not pertain, perform normal diagnostics if needed.

NOTE: Check engine oil level and adjust if needed.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
09-60-40-95	Indicator Engine Oil - Replace (0 - Introduction)	8 - Engine Performance	0.2 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------