Technical Bulletin



SB-10058823-5431

SERVICE BULLETIN				
Classification:	Reference:	Date:		
AT15-017	NTB15-082	October 1, 2015		

2012-2014 VERSA SEDAN; HESITATION ON ACCELERATION AND/OR DTC P0705

APPLIED VEHICLE: 2012-2014 Versa Sedan (N17)

IF YOU CONFIRM:

An **APPLIED VEHICLE** has one or both of the following:

- Hesitation during acceleration
- MIL ON with DTC P0705 (Transmission Range Sensor A Circuit (PRNDL Input)) stored

ACTION:

- 1. Inspect both rear tail lamp assemblies for water intrusion (see page 2 for sample pictures).
- 2. If water intrusion is detected, inspect the circuit board of the tail lamp bulb holder(s) for corrosion (see page 2 for sample pictures).
- 3. If corrosion is found, replace the incident tail lamp assembly(ies).
 - Refer to the Electronic Service Manual (ESM), section EXL-Exterior Lighting System, for tail lamp replacement.
 - See PARTS INFORMATION on page 3.

NOTE:

- Replace only the tail lamp assembly where water intrusion has been detected.
- Do NOT replace the CVT assembly for this incident, if it should occur.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely.

NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.



Figure 1

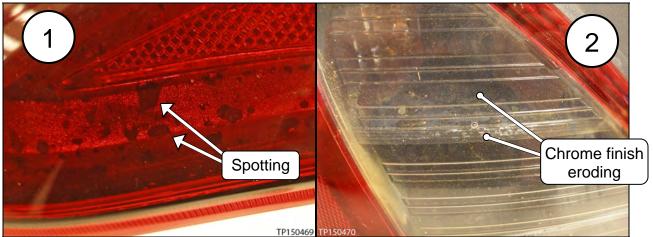


Figure 2 Figure 3

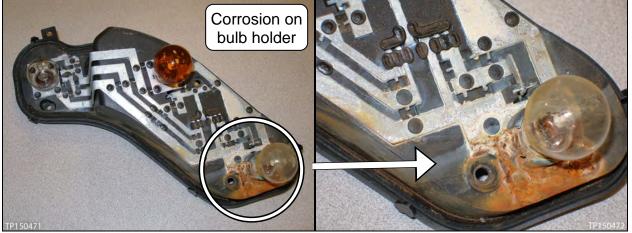


Figure 4 Figure 5

2/3 NTB15-082

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY	
LAMP ASSY-COMBINATION, LH	26555-3AN0A	1	
LAMP ASSY-COMBINATION, RH	26550-3AN0A	1	

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
RPL Tail Lamp	(1)	RE24AA	ZE	32	(2)

⁽¹⁾ Reference the Parts Information table and use the indicated Part number as the PFP.

OR

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
RPL both Tail Lamps	(1)	RE26AA	ZE	32	(2)

⁽¹⁾ Reference the Parts Information table and use the indicated Part number as the PFP.

3/3 NTB15-082

⁽²⁾ Reference the current Nissan Warranty Flat Rate Manual and use the indicated FRT.

⁽²⁾ Reference the current Nissan Warranty Flat Rate Manual and use the indicated FRT.