



Service Bulletin

File in Section: -

Bulletin No.: PIP5272A

Date: August, 2015

PRELIMINARY INFORMATION

Subject: Low Oil Pressure After An Oil And Filter Change

Models: 2014-2015 Chevrolet Silverado
2015 Chevrolet Suburban, Tahoe
2014-2015 GMC Sierra
2015 Yukon Yukon XL
Engine 4.3L LV3 5.3 L83 6.2 L86

This PI was superseded to update Recommendation/Instructions. Please discard PIP5272.

Condition/Concern

Some customers may comment on an SES light P0521 and low oil pressure after an oil and filter change.

Recommendation/Instructions

If this is encountered and the oil and filter were just changed, inspect the oil filter part number.

The correct part number is PF63E 19330000.

The PF48 oil filter will fit, but can cause the oil pressure to go low and DTC P0521 to set.

PF63E part number 19330000 is for the GEN5 V6 and V8.

PF48 is for the GEN4 V8.