



# Service Bulletin

File in Section: -

Bulletin No.: PI1525

Date: August, 2015

## PRELIMINARY INFORMATION

**Subject:** Diagnostic Tips for Airbag Readiness Light On, DTC B101D SYM 00 and C0186, C0196 and/or C0287 Set

**Models:** 2014-2015 Buick Regal  
2015 Chevrolet Malibu Built After June 30, 2014  
2015 Chevrolet Sonic

**Attention:** This PI also applies to any of the above models that may be Export vehicles.  
**Condition/Concern**

A customer or technician may comment that intermittently the Airbag Readiness Light is ON.

Upon further diagnosis, the technician may find DTC B101D SYM 00 and one or more of the following codes (C0186, C0196 and/or C0287) are also set in the SDM (K36 Inflatable Restraint Sensing and Diagnostic Module).

### Recommendation/Instructions

Access the Service Programming System (SPS) to check the K36 Inflatable Restraint Sensing and Diagnostic Module (SDM) for the latest software version.

- If the software version currently in the SDM is prior to part# 13596603, install the updated software.
- If the software version is part# 13596603 or newer, follow normal DTC diagnostics in SI.

Labor Operation	Description	Labor Time
2810525	Inflatable Restraint Sensing and Diagnostic Module Reprogramming with SPS	Use Published Labor Operation Time