

TECHNICAL BULLETIN

J038 NAS3

29 MAY 2015



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

Changes are highlighted in gray

SECTION: 303-00

Emissions Recall: Engine Malfunction Indicator Lamp Illuminated

AFFECTED VEHICLE RANGE:

XF (X250)

Model Year: 2010-2012

VIN: ANR47154-CLS61361

Engine: V8 5.0L Petrol

V8 S/C 5.0L Petrol

XJ Range (X351)

Model Year: 2010-2012

VIN: ANV00001-CLV39426

XK Range (X150)

Model Year: 2010-2014

VIN: ALB32753-EMB54400

MARKETS:

NAS

CONDITION SUMMARY:

This Recall is reinstated with immediate effect. The required SDD software has been revised.

Situation: An issue has been identified on a number of 2010-2012 model year XF (X250) and XJ (X351) vehicles, and 2010-2014 model year XK (X150) vehicles fitted with the 5.0L V8 engine (naturally aspirated and supercharged) within the listed VIN ranges. The condition may cause the engine Malfunction Indicator Lamp (MIL) to illuminate with Diagnostic Trouble Code (DTC) P0316 in addition to one or more of the P0301-P0308 codes stored in the Engine Control Module (ECM). This condition will have no effect on the vehicle's performance, but may reduce the vehicle's ability to control tailpipe emissions.

Action: Retailers are required to **HOLD** all affected vehicles that are within your control and refrain from releasing the vehicles for new or used vehicle sale pending completion of the rework action detailed in this Technical Bulletin. Unsold vehicles should have this performed as part of the Pre-Delivery Inspection (PDI) process but must have it completed prior to vehicle handover to the customer. Affected vehicles already in the hands of customers should be updated at the next available opportunity.

PARTS:



NOTE: an allowance of \$0.50 US for the Authorized Modification Label has been provided and should be claimed using code 'ZZZ001'.



NOTE: * when ordering parts, order only the expected percentage demand of parts identified