

## ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM FOR JUNE 2015

45157 2013-2016 Lincoln MKZ Equipped With Power Decklid - Intermittent Battery Draw Or Intermittently Inoperative Power Decklid - Built On Or Before 6/3/2015

Some 2013-2016 Lincoln MKZs equipped with a power decklid built on or before 6/3/2015 may exhibit an intermittently inoperative power decklid, an intermittent bounce back condition, or an intermittent battery draw that can be isolated to the Rear Gate Trunk Module(RGTM). To correct the concern, reflash the RGTM to the latest calibration using IDS version 95.03 or higher. Make sure you are connected to the internet when entering module programming to obtain the latest updates. Calibration files may also be obtained at [www.motorcraftservice.com](http://www.motorcraftservice.com). Use causal component 14B291 and applicable 12651D labor operations from Section 10 of the SLTS manual for reflash only. This updated software may also remove the chime while closing the power decklid if the decklid is closed by pressing the rear control switch.