



Service Bulletin



SPECIAL COVERAGE

SUBJECT: Special Coverage Adjustment – Excessive Engine Oil Consumption

**MODELS: 2010 Chevrolet Equinox
2010 GMC Terrain
Equipped with 2.4L Engine (LAF)**

This bulletin has been revised to include warranty information for vehicles still covered under the original powertrain warranty. Please discard all copies of bulletin 14159.

CONDITION

Some 2010 model year Chevrolet Equinox and GMC Terrain vehicles, equipped with a 2.4L engine, may exhibit excessive engine oil consumption (less than 2,000 miles per quart of engine oil), due to piston ring wear. If this condition is present, the oil can light may illuminate on the instrument panel or one of the following messages may appear in the Driver Information Center: “Engine Oil Low – Add Oil” or “Oil Pressure Low – Stop Engine”.

SPECIAL COVERAGE ADJUSTMENT

This special coverage covers the condition described above for a period of 10 years or 120,000 miles (193,000 km), whichever occurs first, from the date the vehicle was originally placed in service, regardless of ownership.

Dealers are to replace the 4 piston assemblies. The repairs will be made at no charge to the customer.

For vehicles covered by Vehicle Service Contracts, all eligible claims with repair orders on or after August 15, 2014, are covered by this special coverage and must be submitted using the labor operation codes provided with this bulletin. Claims with repair orders prior to August 15, 2014, must be submitted to the Service Contract provider.

VEHICLES INVOLVED

All involved vehicles are identified by Vehicle Identification Number on the Applicable Warranties section in GM Global Warranty Management system. Dealership service personnel should always check this site to confirm vehicle involvement prior to beginning any required inspections and/or repairs. It is important to routinely use this tool to verify eligibility because not all similar vehicles may be involved regardless of description or option content.

PART INFORMATION

Parts required to complete this special coverage are to be obtained from General Motors Customer Care and Aftersales (GMCC&A).

| Part Number | Description | Quantity/Vehicle |
|--------------------|--|-------------------------|
| 19303450 | Piston Kit | 1 |
| 12637166 | Gasket Kit, Cylinder Head | 1 |
| 12609291 | Gasket Kit, Camshaft Cover | 1 |
| 12635447 | Seal, Chain Package, Timing | 1 |
| 12635427 | Chain Assembly, W/Pmp And Balr Shf | 1 |
| 12649233 | Tensioner Asm - W/Pmp & Balr Shf Chain | 1 |
| 24435052 | Gasket, Engine Front Cover | 1 |
| 12602379 | Seal, Fuel Pump Housing (Oring) | 1 |
| 12608374 | Pipe Asm, Fuel Feed Inter | 1 |
| 12584041 | Seal, Cr/Shf Front Oil | 1 |
| 11589123 | Bolt Asm, Hx Hd W/Con Spr Washer | 1 |
| 11588844 | Bolt, Cm/Shf Posn Actr | 2 |
| 12605566 | Filter, Oil | 1 |
| 19293000 | Oil, Engine, AC Delco DEXOS1 5W30 | 5 |
| 90537293 | Screw Schraube (Connecting Rod) | 8 |
| 88864346 | Sealant, RTV | 2 |
| 90537336 | Guide, Balr Chain | 1 |
| 12346290 | Coolant, Engine, Dexcool Antifreeze | 1 |

SERVICE PROCEDURE

Note: This special policy covers repairs after the original powertrain warranty has expired. For vehicles still covered under the original powertrain warranty, the labor code operations should be used from bulletin 13-06-01-003.


Note: Technicians should perform an oil consumption test to determine if the pistons and rings must be replaced. Follow the latest version of Corporate Bulletin Number 01-06-01-011 to perform an oil consumption test. Before starting the oil consumption test, verify the ECM has latest TIS2web calibrations to adjust the engine oil life monitor to a maximum of 7,500 miles (12,070 km) — Refer to the latest version of Customer Satisfaction Bulletin number 12312.

1. Determine the rate of oil consumption.

- If the oil consumption test indicates that the rate of consumption is less than 1 quart (0.946L) of oil every 2,000 miles (3,200 km), note the oil consumption rate and the date that the ECM was reprogrammed. No further action is required.
- If the oil consumption test indicates that the rate of consumption is greater than 1 quart (0.946 L) of oil every 2,000 miles (3,200 km), note the oil consumption rate, the date that the ECM was reprogrammed and replace the pistons and rings.

Note: The repair is to replace the pistons and rings. In some cases the bore surface may not have a uniform look to the finish (zebra stripes) as shown in Technical Service Bulletin 13-06-01-003F. As a result, some technicians may question whether the engine should be repaired or replaced. After careful evaluation, GM Powertrain has determined that the new pistons and rings will perform correctly in bores that have this appearance so engine replacement should not be necessary. The cylinder bores do not need any machine or honing work performed on them. Refer to Technical Service Bulletin 13-06-01-003F for more information.

Piston and Ring Replacement Procedure

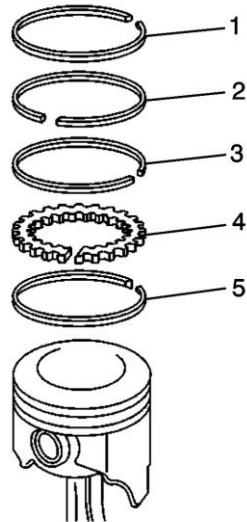

2146346

Note: Review the following service procedures and technical bulletin in SI:

- Engine Replacement
 - Technical Service Bulletin 13-06-01-003F
 - Piston and Connecting Rod Disassemble
 - Piston and Connecting Rod Assemble
 - Piston, Connecting Rod, and Bearing Installation (LAF, LAT, LE5, LE9, LEA, or LUK)
1. Remove the engine from the vehicle.
 2. Remove the pistons from the engine.
 3. Remove the pistons from the connecting rods.
 4. Discard the pistons and piston rings.
 5. Install the new piston rings onto the new pistons.
 6. Install the new pistons onto the connecting rods.
 7. Assemble the engine.
 8. Install the engine into the vehicle.

CUSTOMER REIMBURSEMENT - For US

Customer requests for reimbursement of previously paid repairs to correct the condition described in this bulletin are to be submitted to the dealer by September 30, 2015, unless otherwise specified by state law. If this is not convenient for the customer, they may mail the completed Customer Reimbursement Request Form and all required documents to the GM Customer Assistance Center. Repairs must have occurred within the 10 years of the date the vehicle was originally placed in service, or 120,000 miles, whichever occurs first.

All reasonable and customary costs to correct the condition described in this bulletin should be considered for reimbursement. Any questions or concerns should be reviewed with your GM representative prior to processing the request.

When a customer requests reimbursement, they must provide the following:

- A completed Customer Reimbursement Request Form. This form is mailed to the customer or can be obtained through GM GlobalConnect.
- The name and address of the person who paid for the repair.
- Paid receipt confirming the amount of the repair expense, a description of the repair, and the person or entity performing the repair.

IMPORTANT: GM requires dealers to approve or deny a reimbursement request within 30 days of receipt. If a reimbursement request is approved, the dealer should immediately issue a check to the customer and submit an appropriate warranty transaction for the incurred expense. If a reimbursement request is denied, the dealer MUST provide the customer with a clear and concise explanation, in writing, as to why the request was denied. The bottom portion of the Customer Reimbursement Request Form may be used for this purpose. If the denial was due to missing documents, the customer can resubmit the request when the missing documents are obtained, as long as it is still within the allowed reimbursement period.

Warranty transactions for customer reimbursement of previously paid repairs are to be submitted as required by GM Global Warranty Management. Additional information can also be found in Warranty Administration Bulletin 11-00-89-004.

CUSTOMER REIMBURSEMENT - For Canada and Export

Customer requests for reimbursement of previously paid repairs to correct the condition described in this bulletin are to be submitted to the dealer prior to or by September 30, 2015. Repairs must have occurred within the 10 years of the date the vehicle was originally placed in service, or 193,000 kilometers, whichever occurs first.

When a customer requests reimbursement, they must provide the following:

- Proof of ownership at time of repair.
- Original paid receipt confirming the amount of unreimbursed repair expense(s) (including Service Contract deductibles), a description of the repair, and the person or entity performing the repair.

All reasonable and customary costs to correct the condition described in this bulletin should be considered for reimbursement. Any questions or concerns should be reviewed with your GM representative prior to processing the request.

COURTESY TRANSPORTATION – For US and Canada

The General Motors Courtesy Transportation program is intended to minimize customer inconvenience when a vehicle requires a repair that is covered by the New Vehicle Limited Warranties. The availability of courtesy transportation to customers whose vehicles are within the warranty coverage period and involved in a product program is very important in maintaining customer satisfaction. Dealers are to ensure that these customers understand that shuttle service or some other form of courtesy transportation is available and will be provided at no charge. Dealers should refer to the General Motors Service Policies and Procedures Manual for Courtesy Transportation guidelines.

WARRANTY TRANSACTION INFORMATION

Submit a transaction using the table below. All transactions should be submitted as a ZREG transaction type, unless noted otherwise.

Note: This special policy covers repairs after the original powertrain warranty has expired. For vehicles still covered under the original powertrain warranty, the labor code operations should be used from bulletin 13-06-01-003 as shown below.

Note: To avoid having to "H" route the customer reimbursement transaction for approval, it must be submitted prior to the repair transaction.

| Labor Code | Description | Labor Time | Net Item |
|--|--|------------|----------|
| For use on vehicles still covered under the original powertrain warranty: | | | |
| 4080008 | Oil Consumption Test Setup – No Repair Required | 0.2 | N/A |
| 4080178 | Piston, Connecting Rod and Bearing Replacement (Includes Oil Consumption Test) | 10.4 | N/A |
| For use on vehicles no longer covered under warranty: | | | |
| 9900033 | Oil Consumption Test Setup – No Repair Required | 0.2 | N/A |
| 9900034 | Piston and Piston Ring Replacement (Includes Oil Consumption Test) | 10.4 | N/A |
| 9900035 | Customer Reimbursement Approved | 0.2 | * |
| 9900036 | Customer Reimbursement Denied - For US dealers only | 0.1 | N/A |

* The amount identified in "Net Item" should represent the dollar amount reimbursed to the customer.

CUSTOMER NOTIFICATION

General Motors will notify customers of this special coverage on their vehicles (see copy of typical customer letter included with this bulletin - actual divisional letter may vary slightly).



August 2014

Dear General Motors Customer:

As the owner of a 2010 model year Chevrolet Equinox or GMC Terrain, your satisfaction with our product is very important to us.

This letter is intended to make you aware that some 2010 model year Chevrolet Equinox and GMC Terrain vehicles, equipped with a 2.4L engine, may exhibit excessive engine oil consumption (less than 2,000 miles per quart of engine oil), due to piston ring wear. Check your oil level periodically. Also, if this condition is present, the oil can light may illuminate on your instrument panel or you may have one of the following messages in the Driver Information Center: "Engine Oil Low – Add Oil" or "Oil Pressure Low – Stop Engine". See your owner manual for additional information on what to do if the vehicle displays one of these messages.

Do not take your vehicle to your GM dealer as a result of this letter unless you believe that your vehicle has the condition as described above.

What We Have Done: General Motors is providing owners with additional protection for the condition described above. If this condition occurs on your 2010 model year Chevrolet Equinox or GMC Terrain within 10 years of the date your vehicle was originally placed in service or 120,000 miles (193,000 km), whichever occurs first, the condition will be repaired for you at **no charge**. Diagnosis or repair for conditions other than the condition described above is not covered under this special coverage program.

What You Should Do: If you believe that your vehicle has the condition described above, repairs and adjustments qualifying under this special coverage must be performed by a General Motors dealer. You may want to contact your GM dealer to find out how long they will need to have your vehicle so that you may schedule the appointment at a time that is convenient for you. This will also allow your dealer to order parts if they are not already in stock. Keep this letter with your other important glove box literature for future reference.

Reimbursement: If you have paid for repairs for the condition described in this letter, please complete the enclosed reimbursement form and present it to your dealer with all required documents. Working with your dealer will expedite your request, however, if this is not convenient, you may mail the completed reimbursement form and all required documents to Reimbursement Department, PO Box 33170, Detroit, MI 48232-5170. The completed form and required documents must be presented to your dealer or received by the Reimbursement Department by September 30, 2015, unless state law specifies a longer reimbursement period.

If you have any questions or need any assistance, just contact your dealer or the appropriate Customer Assistance Center at the number listed below.

| Division | Number | Text Telephones (TTY) |
|-----------------------|----------------|-----------------------|
| Chevrolet | 1-800-222-1020 | 1-800-833-2438 |
| GMC | 1-800-462-8782 | 1-888-889-2438 |
| Guam | 65-6267-1752 | |
| Puerto Rico – English | 1-800-496-9992 | |
| Puerto Rico – Español | 1-800-496-9993 | |
| Virgin Islands | 1-800-496-9994 | |

We are sorry for any inconvenience you may experience; however, we have taken this action in the interest of your continued satisfaction with our products.

Jim Moloney
General Director,
Customer and Relationship Services

Enclosure
14159

GM CUSTOMER CARE AND AFTERSALES
DCS3519
URGENT - DISTRIBUTE IMMEDIATELY

Date: January 29, 2015

Subject: 14159A – Special Coverage
Excessive Engine Oil Consumption
Revised Warranty Transaction Information Section

Models: 2010 Chevrolet Equinox and GMC Terrain Equipped with
2.4L Engine (LAF)

To: All Chevrolet and GMC Dealers

Attention: General Manager, Service Advisor, Service Manager, Parts and
Service Director, Parts Manager, Used Vehicle Sales Manager,
and Warranty Administrator

This bulletin has been revised to include warranty information for vehicles still covered under the original powertrain warranty. Please discard all copies of bulletin 14159.

END OF MESSAGE
GM CUSTOMER CARE AND AFTERSALES