
	GROUP BOD	MODEL 2015~2016MY Sedona (YP)
	NUMBER 119	DATE November 2015
TECHNICAL SERVICE BULLETIN		
SUBJECT: COMBINED TSB/SERVICE ACTION: FUEL FILLER DOOR ADJUSTMENT (SA 202)		

This bulletin provides the procedure to adjust the fuel filler door spring of some 2015~2016MY Sedona (YP) vehicles, produced from July 29, 2014 through June 15, 2015, which may exhibit a fuel filler door that may not pop open or does not open far enough. To correct and/or prevent this condition, Kia is requesting the completion of this Service Action on all affected vehicles, including those in dealer stock, prior to delivery. Before conducting the procedure, verify the vehicle is included in the list of affected VINs.

For vehicles not on the Affected Vehicles list, but with a customer concern as described above, perform the following procedure outlined in this bulletin and submit a warranty claim per "customer concern" (Standard TSB) claim information on page 4.

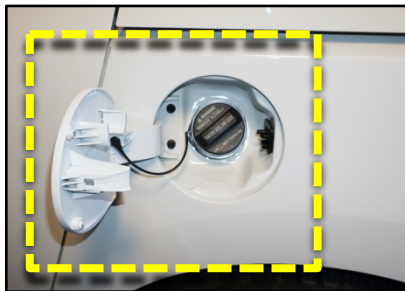

*** NOTICE**

A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.

Repair status for a VIN is provided on WebDCS (Service> Warranty Coverage> Warranty Coverage Inquiry> Campaign Information). Not completed Recall / Service Action reports are available on WebDCS (Consumer Affairs> Not Completed Recall> Recall VIN> Select Report), which includes a list of affected vehicles.

This issue number is SA 202.

File Under: <Body>

-
- Circulate To:** **General Manager** **Service Manager** **Parts Manager**
 Service Advisor(s) **Technician(s)** **Body Shop Manager** **Fleet Repair**


SUBJECT: COMBINED TSB / SERVICE ACTION: FUEL FILLER DOOR ADJUSTMENT (SA 202)

Service Procedure:


1. Press the fuel door release button on the dash.

*** NOTICE**

Be sure to wear disposable gloves throughout this procedure.

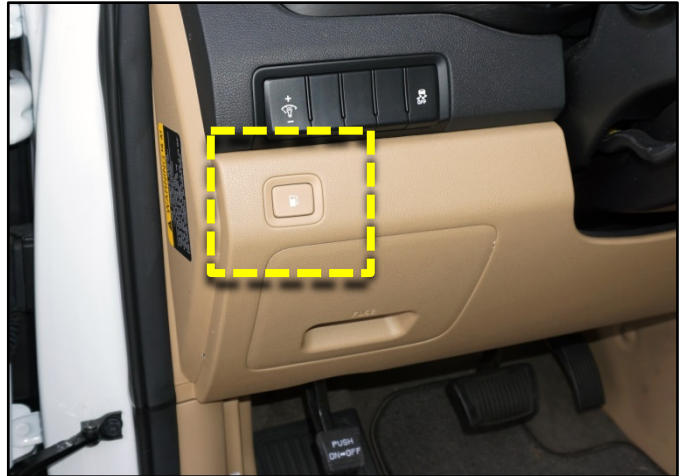


2. Fully open the fuel door and locate the spring, as shown.

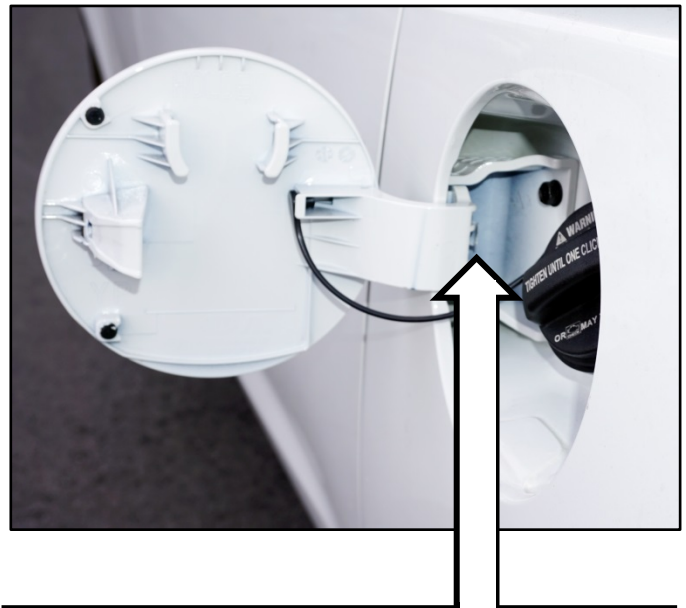

3. Use a ruler to measure the distance from the spring to the edge of the door hinge, as shown. If the distance measured is less than 1.1" (27.9 mm), proceed to the next step. If the distance is greater than 1.1" (27.9mm), no further action is required.


*** NOTICE**

Fuel filler door removed for illustration purposes only.

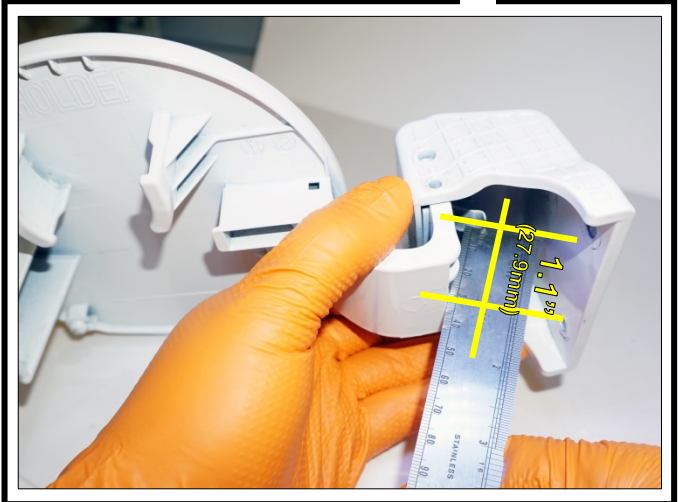


**SUBJECT: COMBINED TSB / SERVICE ACTION: FUEL FILLER DOOR
ADJUSTMENT (SA 202)**

4. Use a trim panel removal tool to carefully push the spring open, as shown.

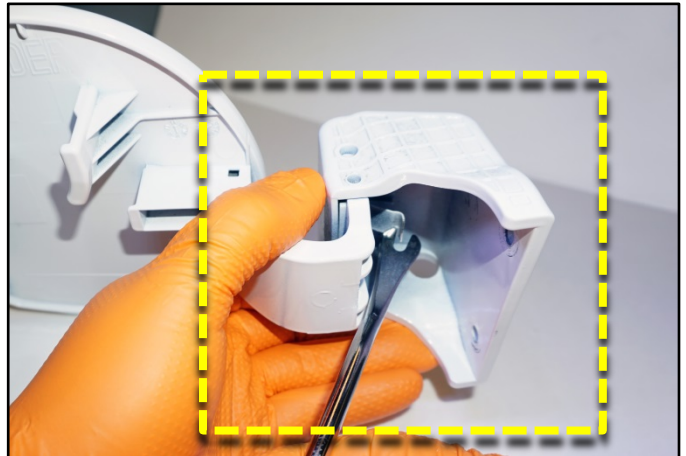

5. Use a ruler to measure the spring deflection. The desired adjustment range for the spring should be between 1.2" ~ 1.29" (30mm ~ 32mm).

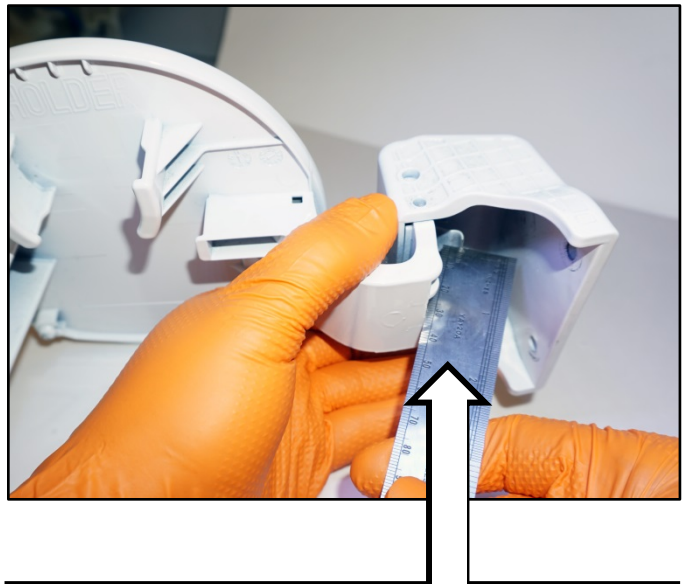

6. Open the fuel filler door, repeatedly, to verify proper operation.

SUBJECT: COMBINED TSB / SERVICE ACTION: FUEL FILLER DOOR ADJUSTMENT (SA 202)

AFFECTED VEHICLE PRODUCTION RANGE:

Model	Production Date Range
Sedona (YP)	From July 29, 2014 through June 17, 2015

SERVICE ACTION CLAIM INFORMATION:

Claim Type	Causal P/N	Qty	N Code	C Code	Repair Description	Labor Op Code	Time	Related Parts	Qty
V	69510 A9000	0	N99	C99	(SA 202) Fuel Filler Door Repair	150092R0	0.2 M/H	N/A	0

STANDARD WARRANTY CLAIM INFORMATION:

Use this information only to file a warranty claim for vehicles for which:

1. A customer complains of the same concern, as described on Page 1.
2. The VIN does not appear on the Affected Vehicles list for Service Action 202.
3. The vehicle model year and production date range are as identified in this bulletin.

Claim Type	Causal P/N	Qty.	N Code	C Code	Repair Description	Labor Op Code	Time	Related Parts	Qty.
W	69510 A9000	0	A36	ZZ3	(BOD 119) Fuel Filler Door Repair	69510F03	0.2 M/H	N/A	0

*** NOTICE**

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference SA 202 when accessing the WebDCS system.