QUALITY DRIVEN® SERVICE

SERVICE BULLETIN

APPLICABILITY:		NUMBER:	
	2012-14 Impreza and XV Crosstrek	DATE:	02/19/14
	(Including Hybrid)	REVISED:	05/05/15
SUBJECT:	New Electric Power Steering (EPS) Control Unit for DTC C2532		

INTRODUCTION

If you receive a customer concern of the EPS warning light coming on and diagnostics show a DTC C2532 stored in memory, a new EPS control unit is now available to address this code. There may also be a customer concern of increased steering effort along with the EPS warning light coming on.

COUNTERMEASURE IN PRODUCTION

The new EPS control module was incorporated into production during November, 2013 starting with the following VINs:

MODEL	STARTING VIN		
Forester	E*520370		
Impreza 4-Door	E*012138		
Impreza 5-Door XV Crosstrek (including HEV)	E*241320		

PART INFORMATION

MODEL	MODEL YEAR	SPECIFICATION	NEW PART NUMBER	
Forester	2014	N/A & Turbo	34710SG050	
Impreza	2012		34710FJ001	
	2013	4 Door and 5-Door		
	2014		34710FJ110	
XV Crosstrek	2013		34710FJ031	
	2014	5-Door	34710FJ120	
XV Hybrid	2014		34710FJ082	

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD

RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They

are written to inform those technicians of conditions that may occur in some vehicles, or

to provide information that could assist in the proper servicing of the vehicle. Properly

trained technicians have the equipment, tools, safety instructions, and know-how

to do the job correctly and safely. If a condition is described, DO NOT assume that this

Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

Continued...

SUBARU OF AMERICA, INC. IS "ISO 14001 COMPLIANT"

The international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

SERVICE PROCEDURE / INFORMATION

Once you verify the EPS light illuminating and a DTC C2532 "ECU Failure 2" is is current or stored in memory, replace the EPS control module with a new part from the table above. Follow the installation procedure outlined in the applicable Service Manual.

WARRANTY / CLAIM INFORMATION

For vehicles within the Basic New Car Limited Warranty period, this repair may be claimed using the following information

LABOR DESCRIPTION	LABOR	FAIL	LABOR
	OPERATION #	CODE	TIME
EPS Control Unit R&R for TSB# 04-13-14	A659-022	UJF-48	0.4