



GROUP
Body

MODEL
**2016MY
Sorento (UMa)**

NUMBER
PS412

DATE
June 2015



TECHNICAL OPERATIONS

SUBJECT: SUN VISOR LIGHTS ARE INOPERABLE OR STAY ON

When diagnosing a concern related to inoperable, or constantly on, sun visor courtesy lights, check the condition of the Interior Lamp 10A fuse. If the fuse is blown, inspect the harness on both sun visors for the possibility of frayed wiring causing a short to ground (A) or a severed harness creating an open circuit. If either sun visor harness is visibly damaged, replace the affected sun visor to resolve the concern. Finally, replace the Interior Lamp fuse, if needed, and test for proper sun visor courtesy light operation.

