

- ATTENTION:**
- GENERAL MANAGER
 - PARTS MANAGER
 - CLAIMS PERSONNEL
 - SERVICE MANAGER

IMPORTANT - All Service Personnel Should Read and Initial in the boxes provided, right.

© 2014 Subaru of America, Inc. All rights reserved.



QUALITY DRIVEN® SERVICE

SERVICE BULLETIN

APPLICABILITY: 2015MY WRX STI


NUMBER: 03-75-15

SUBJECT: Change to Driver Controlled Center Differential (DCCD) Control Module

DATE: 09/09/15

INTRODUCTION

This bulletin announces a change to the DCCD control module to prevent unnecessary illumination of the DCCD warning light. The logic in the DCCD module can detect differences in tire circumference due to tire size / wear inconsistencies. On some 2015 MY vehicles, this logic was too sensitive and could cause false illumination of the DCCD warning light.

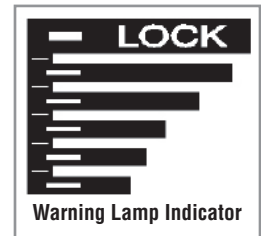

PRODUCTION CHANGE INFORMATION:

The new DCCD control modules were incorporated into production starting with VIN **F*832766**.

PART INFORMATION

The part number for the new DCCD control module is **32520AA331**.

SERVICE PROCEDURE / INFORMATION

If a customer has a concern of the DCCD light coming on and the vehicle is before the production change, verify the tires are of the same size and circumference (within 1/4") before ordering / replacing the DCCD control module. Follow the procedure in the applicable Service Manual when replacement is necessary. If any tires are found to have more than 1/4" difference in circumference, tire replacement may be required. Continued used and operation of the vehicle with tires having more than 1/4" difference in circumference may result in damage to the vehicle's drivetrain and/or clutch components. Failure to correct this concern may result in denial of warranty coverage for a failure of the drivetrain or clutch components as a result of operation with mismatched tires.

WARRANTY / CLAIM INFORMATION

For vehicles within the Basic New Car Limited Warranty period or covered by an active Subaru Added Security Classic or Gold plan this repair may be submitted using the following claim information:

LABOR DESCRIPTION	LABOR OPERATION #	FAIL CODE	LABOR TIME
DCCD TESTING & DIAGNOSIS	B561-001	USM-48	0.5
DCCD CONTROL MODULE R&R	C568-141		0.3

Continued...

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

SUBARU OF AMERICA, INC. IS ISO 14001 COMPLIANT

ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

REMINDER: SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.

Always refer to STIS for the latest service information before performing any repairs.