

- ATTENTION:**
- GENERAL MANAGER
 - PARTS MANAGER
 - CLAIMS PERSONNEL
 - SERVICE MANAGER

IMPORTANT - All Service Personnel Should Read and Initial in the boxes provided, right.

© 2015 Subaru of America, Inc. All rights reserved.



QUALITY DRIVEN® SERVICE

SERVICE BULLETIN


APPLICABILITY: 2015-16MY Legacy and Outback Models
SUBJECT: Design Change to the Fuel Filler Door Assembly

NUMBER: 09-61-15R
DATE: 11/24/15
REVISED: 12/01/15

INTRODUCTION

This bulletin announces a design change to the fuel filler door (saucer) assembly to address customer concerns of it being difficult to open and / or close. The striker portion's shape has been changed as shown in the cross-section illustration below along with the type of plastic material used in the construction of the saucer assembly.

IMPORTANT: This bulletin replaces TSB 09-60-15R dated 10/26/15.

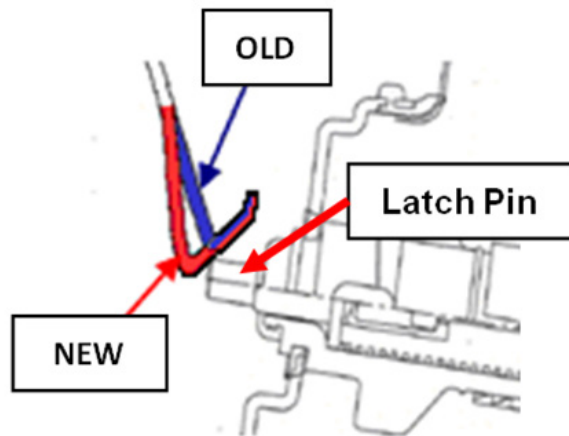

PRODUCTION CHANGE INFORMATION:

The new saucer assembly was incorporated into production during August, 2015 starting with the following VINs: Legacy: G*005915 and Outback: G*208318.

PART INFORMATION:

DESCRIPTION	PART NUMBER	APPLICATION
SAUCER COMPL	51478AL00C	Outback
	51478AL01C	Legacy
SEAL-Saucer, FUEL	51467AL07A	Legacy / Outback

Continued...

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

SUBARU OF AMERICA, INC. IS ISO 14001 COMPLIANT


ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

SERVICE PROCEDURE / INFORMATION

If a complaint of the fuel filler door being hard to open or close is confirmed, replace the saucer assembly using the applicable parts listed above following the procedure in the applicable Service Manual.

NOTE: The new plastic lock ring (seal) shown below **must** be replaced also as it is a one-time use part.

- **NEVER** attempt to re-use a previously installed part.
- **ALWAYS** take precautions to protect the vehicle finish when removing / installing the assembly.

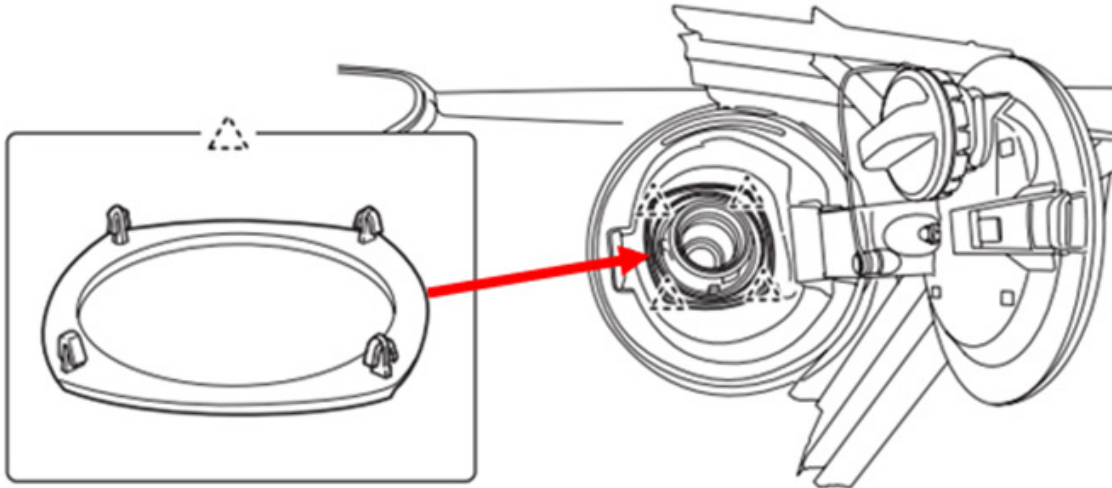

WARRANTY / CLAIM INFORMATION

For vehicles within the Basic New Car Limited Warranty period or covered by a Subaru Added Security Gold plan, this repair may be submitted using the following claim information:

LABOR DESCRIPTION	LABOR OPERATION #	FAIL CODE	LABOR TIME
FUEL DOOR SAUCER ASSY R&R	A926-421	XIK-43	0.4

IMPORTANT REMINDERS:

- SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.
- Always check for any open recalls or campaigns anytime a vehicle is in for servicing.
- Always refer to STIS for the latest service information before performing any repairs.