

TECHNICAL BULLETIN
JTB00398NAS1
05 JAN 2015



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 415-00

Parking Aid Sensors-Front Incorrectly Installed

AFFECTED VEHICLE RANGE:

F-TYPE (X152)

Model Year: 2014-2015

VIN: K10097-K16704

MARKETS:

NAS

CONDITION SUMMARY:

Situation: The Parking Aid sensors-Front may falsely detect objects that are not there.

Cause: This may be caused by incorrectly installed Parking Aid sensors-Front which work loose and become misaligned.

Action: Should a customer express this concern, follow the Service Instruction outlined below.

PARTS:

No Parts Required

TOOLS:

No Tools Required

WARRANTY:

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**

 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Parking aid sensors-Front - Remove and refit	86.62.38	1.6	7	JDE28658

 **NOTE: Normal Warranty procedures apply.**

SERVICE INSTRUCTION:

1. Remove the front bumper cover (see TOPIx Workshop Manual, section 501-19).
2. Remove the Parking Aid Sensors-Front from the bumper cover.
3. Install each Parking Aid Sensor in turn to the bumper cover, ensuring there is a 'double click' as they are installed into the retaining clips.
4. Install the front bumper cover (see TOPIx Workshop Manual, section 501-19).