TOPIx - SSM72219 - F TYPE 16 MY SD Card fails to initialise

Reference	SSM72219
Models	F-TYPE / X152
Title	F TYPE 16 MY SD Card fails to initialise
Category	Electrical
Last modified	02-Apr-2015 00:00:00
Symptom	204000 Instrumentation
Attachments	SD Card Inspection.pdf
Content	Issue: SD card fails to initialise

Cause: This issue may be caused by the SD micro switch being in the wrong position (i.e. Locked) When the SD card is in locked position the head unit may not detect the card.

Action: Check the SD switch position is always in the unlocked position as per the attachment.

If the SD card is found with the switch in the wrong position, correct the switch position and reinsert into SD card slot and carry out the following process.

1.

a) Switch off the car & allow car to go to sleep (3-4 minutes) OR;

b) If re-inserted before shutting down the vehicle - a pop-up should appear on the screen. On the pop-up, select "Retry" The system will now reset and initialise and then continue from step 3 as listed below.

2.Power on the car wait for home screen to appear

3.Select navigation from hard - key

4. Accept navigation caution and wait for navigation to initialise

5. Check current car position is correct on the map. (Vehicle may need to be outside to perform this)

SD Card Visual Inspection

