

TECHNICAL BULLETIN
JTB00442NAS1
12 AUG 2015



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 310-01

Fuel Tank Difficult to Fill

AFFECTED VEHICLE RANGE:

XF (X250)

Model Year: 2010-2015
VIN: R47154-U88785
Manufacturing Plant: Castle Bromwich

MARKETS:

NAS

CONDITION SUMMARY:

Situation: The fuel tank may be difficult to fill, with the fuel delivery 'cutting out' several times.

Cause: This may be caused by the fuel tank filler pipe profile causing an air lock.

Action: Should a customer express this concern, follow the Service Instruction below.

PARTS:



NOTE: refer to the table FUEL TANK FILLER PIPE AND FUEL TANK CAP below for more information.

C2Z31313	LEV II fuel tank filler pipe	Quantity: 1
C2Z31314	LEV III fuel tank filler pipe	Quantity: 1
C2D38206	One-click fuel tank filler cap	Quantity: 1

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:



NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIX to obtain the latest repair time.



NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Fuel tank filler pipe - Renew - 2.0L GTDi; 3.0L SC V6	19.55.33	1.2	42	C2Z25975
Fuel tank filler pipe - Renew - 4.2L NA V8; 5.0L NA/SC V8	19.55.33	1.0	42	C2Z25975



NOTE: Normal Warranty procedures apply.

FUEL TANK FILLER PIPE AND CAP

ENGINE VARIANT	FUEL TANK FILLER PIPE	FUEL TANK FILLER PIPE CAP
All except 2015MY 3.0L SC V6	LEV II	One-click fuel tank filler cap
2015MY 3.0L SC V6	LEV III	Use the original fuel tank filler pipe cap

SERVICE INSTRUCTION:

1. Replace the fuel tank filler pipe. (see TOPIx Workshop Manual, Section 310-01).
 - Replace the fuel tank filler pipe cap (if required).