

<b>Reference</b>	SSM72206
<b>Models</b>	F-TYPE / X152 XE / X760 XF / X250 XF / X260 XJ / X351
<b>Title</b>	Fault code F000-63/U3000-63 logged in the KVM(Keyless vehicle module)
<b>Category</b>	Electrical
<b>Last modified</b>	18-Sep-2015 00:00:00
<b>Symptom</b>	203000 Basic Electrical

**Content****Issue**

Only applicable to software versions 30.3 (GEN 3) FK72-14C104-AF and 29.3 (GEN 2) DPLA-14C104-AG

When checking for fault codes logged in the KVM (keyless vehicle module) also known as the RFA (remote function actuator) F000-63/U3000-63, Control Module - Circuit/ Component Protection Time-Out is logged.

**Cause**

This DTC is set when the KVM has gone through a "self reset"

**Action**

This DTC will not have any effect on functionality. The module must not be replaced .Please carryout a DTC clear. There is a possibility that it will keep appearing

This issue will be resolved with a later release of software.