

## **\*\* 2015 OUTLANDER SPORT 2.4L \*\***

### **EXHAUST MANIFOLD BRACKET INSPECTION AND INSTALLATION INSTRUCTIONS**

#### **PURPOSE**

Specific 2015 Outlander Sport vehicles may have been assembled without an exhaust manifold support bracket. If the bracket is not installed, the manifold may crack after being in long-term operation. Dealers who have received affected vehicles will be contacted individually and requested to inspect and, if necessary, install the missing bracket. Instructions follow:


#### **REQUIRED TOOLS**

- Ratchet and socket
- Torque wrench

#### **REQUIRED PARTS**

Contact Techline for parts release. Parts will be shipped overnight.

- Qty. 1: Exhaust Manifold Bracket – P/N 1555A495
- Qty. 2: Bolt – P/N MF247891

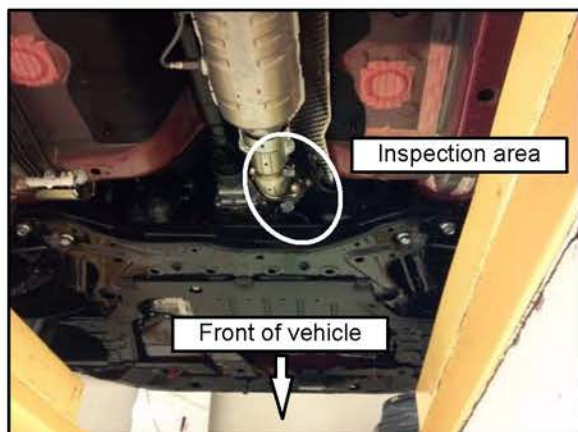


#### **INSPECTION PROCEDURE**

Visually inspect from under the vehicle (see attached photos).


From underneath the vehicle, the inspection area is on the passenger's side of the vehicle centerline, above the front cross member, where the manifold bolts to the exhaust pipe (see photo in step 2).

If the bracket is installed, submit a warranty claim for inspection only. See the Warranty Information section of these instructions.

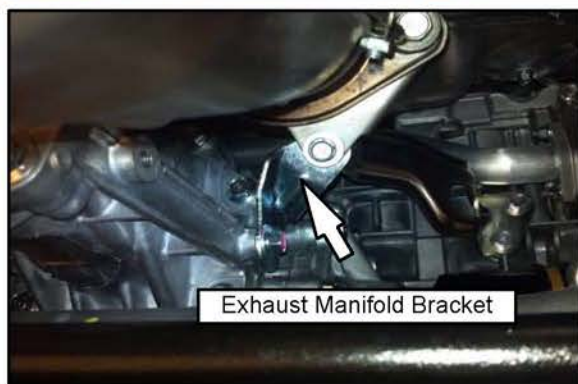

#### **REPAIR PROCEDURE**

1. If no bracket is installed, install a bracket using two bolts.

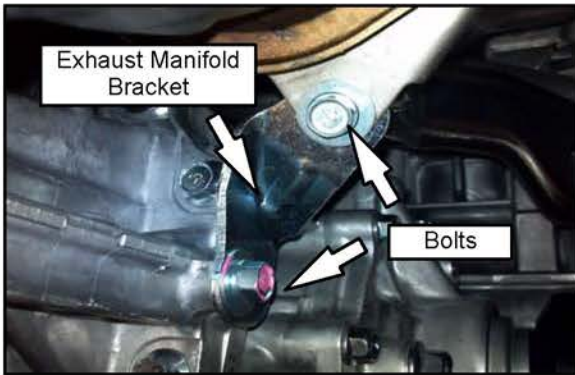

2. Contact Techline to obtain parts.
3. Install the bracket using 2 bolts (provided).

Torque to 15–25 Nm (12–18 ft lbs).

## WARRANTY INFORMATION

Use the following information to claim for this inspection and repair procedure.

### EXHAUST MANIFOLD BRACKET INSPECTION & INSTALLATION

<i>Nature Code:</i>	60D	<i>Cause Code:</i>	400
<i>Labor Operation:</i>	153110 00	<i>Time Allowance:</i>	0.2 hrs. Inspection only
<i>Warranty Coverage:</i>	Basic Coverage		0.3 hrs. Inspection and installation of missing bracket