

© 2015 Mazda Motor of America, Inc.


<b>Subject:</b> REAR MUDGUARD IS WARPED CAUSING POOR APPEARANCE/NOISE	<b>Bulletin No:</b> 09-028/15
	<b>Last Issued:</b> 07/24/2015

## APPLICABLE MODEL(S)/VINS

2014-16 Mazda3 (Mexico built) vehicles with VINs starting with 3MZ

## DESCRIPTION

Some vehicles may exhibit a warped rear mudguard with the surface edge (A) visible from outside the vehicle, causing a poor appearance. In the worst case, it could touch the tire and cause a rubbing noise. The deformation is due to product variation.

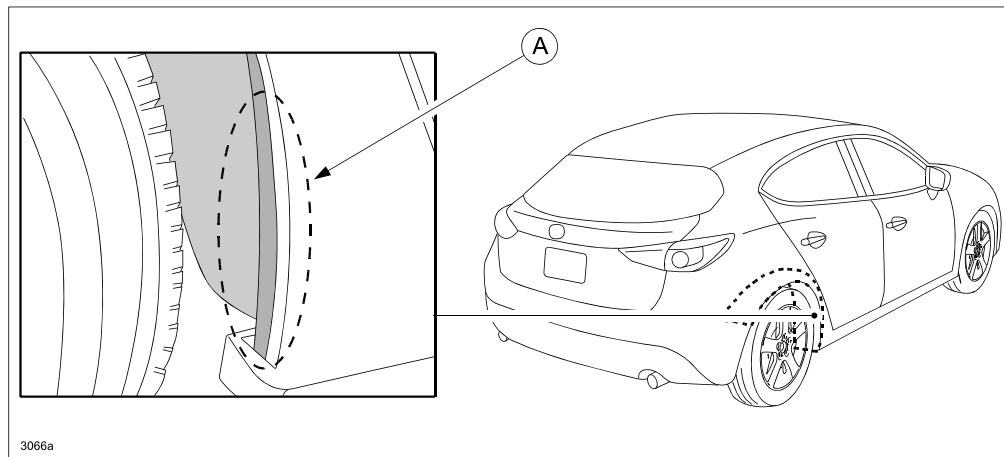

Customers having this concern should have their vehicle repaired using the following repair procedure.

## REPAIR PROCEDURE

1. Verify customer concern.
2. Replace mud guards (both sides) with ones used for Japan production Mazda3 (JM1) according to the instructions on MS3 online or the Workshop Manual (section 09-16 MUDGUARD REMOVAL/INSTALLATION).
3. Verify repair.

## PART(S) INFORMATION

Part Number	Description	Qty.
B45A-56-1H1	Guard (R), mud-rear	1
B45A-56-1J1	Guard (L), mud-rear	1

## WARRANTY INFORMATION

**NOTE:**

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty.
- Additional diagnostic time cannot be claimed for this repair.
- This TSB can be performed by D329 Mazda Certified Lube Technicians.

Warranty Type	A
Symptom Code	87
Damage Code	9B
Part Number Main Cause / Qty.	B45A-56-1H1 / 1
Related Part Number / Qty.	B45A-56-1J1 / 1
Operation Number / Labor Hours:	XXL5NXRX / 0.4 Hrs. (Rear Mud Guard, R&R both sides)
TSB can be performed by D329 Mazda Certified Lube Technicians:	Yes